



**DESIGNATED SUBSTANCE AND
HAZARDOUS MATERIALS SURVEY
PIN: 633560
1968 Woodview Avenue, Toronto,
ON**

Rouge National Urban Park

March 18, 2020

Prepared for:

Public Services and Procurement
Canada on behalf of Parks Canada
Agency
4900 Yonge Street
Toronto ON M2N 6A6

Prepared by:

Stantec Consulting Ltd.
18-15 Cedar Pointe Drive
Barrie ON L4N 5R7

Stantec Project No: 122151011
PSPC Project No: R.099832.001



Table of Contents

EXECUTIVE SUMMARY	i
1.0 INTRODUCTION	1.1
2.0 SCOPE	2.1
3.0 DESIGNATED SUBSTANCES AND HAZARDOUS BUILDING MATERIALS ASSESSMENT	3.1
3.1 FACILITY DESCRIPTION	3.1
3.2 DOCUMENT REVIEW.....	3.1
3.3 PROJECT-SPECIFIC LIMITATIONS	3.1
3.4 ASBESTOS.....	3.1
3.4.1 Methodology	3.1
3.4.2 Findings	3.2
3.4.3 Recommendations	3.6
3.5 LEAD.....	3.7
3.5.1 Methodology	3.7
3.5.2 Findings	3.8
3.5.3 Recommendations	3.9
3.6 MERCURY.....	3.10
3.6.1 Methodology	3.10
3.6.2 Findings	3.10
3.6.3 Recommendations	3.10
3.7 SILICA.....	3.10
3.7.1 Methodology	3.10
3.7.2 Findings	3.10
3.7.3 Recommendations	3.10
3.8 POLYCHLORINATED BIPHENYLS	3.11
3.8.1 Methodology	3.11
3.8.2 Findings	3.11
3.8.3 Recommendations	3.12
3.9 HALOCARBONS.....	3.12
3.9.1 Methodology	3.12
3.9.2 Findings	3.12
3.9.3 Recommendations	3.12
3.10 MOULD.....	3.12
3.10.1 Methodology	3.12
3.10.2 Findings	3.12
3.10.3 Recommendations	3.13
3.11 UREA FORMALDEHYDE FOAM INSULATION	3.13
3.11.1 Methodology	3.13
3.11.2 Findings	3.13
3.11.3 Recommendations	3.13



3.12	OTHER DESIGNATED SUBSTANCES: ACRYLONITRILE, ARSENIC, BENZENE, COKE OVEN EMISSIONS, ETHYLENE OXIDES, ISOCYANATE, VINYL CHLORIDE.....	3.13
3.12.1	Methodology	3.13
3.13	RADIOACTIVE SOURCES.....	3.14
3.13.1	Methodology	3.14
3.13.2	Findings	3.14
3.13.3	Recommendations	3.14
3.14	FUEL OIL AND/OR WASTE OIL STORAGE AND CHEMICAL STORAGE	3.14
3.14.1	Methodology	3.14
3.14.2	Findings	3.15
3.14.3	Recommendations	3.15
3.15	LIMITATIONS.....	3.15
3.15.1	Physical and Sampling Limitations	3.15
4.0	CLOSURE.....	4.1

LIST OF TABLES

Table 1: Summary of Designated Substance and Hazardous Materials	iv
Table 2: Summary of O. Reg 278/05 Sampling Requirements.....	3.2
Table 3: Asbestos-Containing Material Occurrences	3.4
Table 4: Lead-Containing Paint Samples.....	3.8
Table 5: Mould and Water Damage Findings.....	3.13

LIST OF APPENDICES

APPENDIX A	STANDARDS AND GUIDELINES
APPENDIX B	SITE PHOTOGRAPHS
APPENDIX C	FLOOR PLANS
APPENDIX D	SUMMARY OF RESULTS OF ANALYSIS OF BULK SAMPLES FOR ASBESTOS
APPENDIX E	LABORATORY ANALYTICAL REPORT – ASBESTOS: POLARIZED LIGHT MICROSCOPY
APPENDIX F	SUMMARY OF RESULTS OF ANALYSIS OF PAINT CHIP SAMPLES FOR LEAD CONTENT
APPENDIX G	LABORATORY ANALYTICAL REPORT – LEAD: PAINT CHIP ANALYSIS
APPENDIX H	EVALUATION CRITERIA FOR ASSESSING ASBESTOS- CONTAINING MATERIALS



Executive Summary

Stantec Consulting Ltd. (Stantec) was engaged by Public Services and Procurement Canada (PSPC) on behalf of Parks Canada Agency (PCA) to conduct a designated substances and hazardous materials survey of the house at Property Identification Number (PIN) 633560 located at 1968 Woodview Avenue in Toronto, Ontario.

The purpose of the survey was to identify actual and potential designated substances and hazardous building materials and update the asbestos inventory in the PCA asbestos management plan for the Rouge National Urban Park (RNUP). The work was carried out in accordance with the requirements of the *Canada Labour Code Part II, Canada Occupational Health and Safety Regulations, National Joint Council Occupational Health and Safety Directive, PCA Asbestos Management Standard & Procedures* (December 2018) and provincial regulations including Ontario Regulation 278/05 Designated Substance - Asbestos on Construction Projects and in Buildings and Repair Operations (O. Reg. 278/05). The designated substances assessment list includes those substances designated under the *Ontario Occupational Health and Safety Act* and included (but were not limited to) asbestos, lead, mercury and silica as the most likely to be present. In addition to designated substances, the hazardous building materials considered in this assessment included: polychlorinated biphenyls (PCBs); halocarbons; urea-formaldehyde foam insulation (UFFI); mould; fuel oil and/or waste oil storage; chemical storage; and radioactive materials.

The following designated substances and hazardous materials were identified to be present.

- Asbestos
- Lead
- Mercury
- Silica
- Polychlorinated biphenyls
- Mould
- Radioactive sources

Halocarbons, fuel oil and/or waste oil storage, chemical storage and UFFI were not observed to be present.

Other Designated Substances (acrylonitrile, arsenic, benzene, coke oven emissions, ethylene oxide, isocyanates, vinyl chloride) are not typically a concern in building materials, and therefore these substances were not investigated.

BGIS is the Property Manager for the RNUP and the National Service Call Centre (NSCC) is where tenants can address maintenance requests, including emergencies.



Asbestos-Containing Materials

Samples of suspect asbestos-containing materials (ACMs) were collected and analyzed for asbestos. Building materials suspected to be asbestos-containing have been identified by laboratory analysis to contain asbestos. A material is considered to be asbestos-containing if it has an asbestos content of 0.5% or more as defined by O. Reg. 278/05.

Damaged ACMs should be removed/repared in accordance with abatement operations. Recommended actions for each occurrence of asbestos is provided in Table 1 below. Presumed ACMs and ACMs observed to be in good condition and can be left in place. No abatement operations are required for materials in good condition.

On an annual basis, the ACMs and PACMs inventory should be updated through a reassessment based primarily on change in condition and quantity.

Lead

Samples of paint applications were collected and submitted for lead content analysis. Paint applications were identified by laboratory analysis to contain lead over 90 ppm. PCA uses the *Surfacing Coating Materials Regulation SOR/2016-193* limit of 90 ppm as the criteria to manage paint applications.

Lead may also be present in the following materials:

- Other coating applications not tested
- Older electrical wiring materials and sheathing
- Solder used on domestic water lines
- Solder used in bell fittings for cast iron pipes
- Solder used in electrical equipment
- Ceramic tile glaze
- Vent and pipe flashings

Paint applications observed to be in poor condition should be cleaned up by removing loose paint following proper lead abatement procedures and repainting. Paint applications in good condition can remain in place.

Mercury

Mercury vapour within light fixtures or other equipment such as thermostats poses no risk to workers or occupants provided the mercury containers remain intact and undisturbed.

Complete removal of mercury-containing equipment is required prior to demolition or renovation activities that may disturb the equipment. Prior to demolition work or renovation, the light tubes and thermostats must be removed and stored in a safe, secure location or disposed of following the requirements of *R.R.O. 1990, Regulation 347 General - Waste Management*, as amended (R.R.O. 1990, Reg. 347) under the EPA.



Silica

Silica in its undisturbed states does not pose a concern in its present state.

Precautions should be taken as required during renovation projects impacting materials expected to contain silica (i.e., coring through concrete slabs, demolition of masonry or concrete units, ceramic tiles, brick, etc.) where dust may be generated. Whenever practical, changing how a process is performed to lower the silica exposure is preferable. Wet methods reduce dust and should be used whenever practical, particularly in cutting, grinding, and drilling operations.

Polychlorinated Biphenyls (PCBs)

Fluorescent lamp ballasts that may contain PCBs can be managed in place, where these items are operating and in good condition. No further action is currently required until such time that renovation or demolition activities are to be conducted, or until 2025, when PCB-containing ballasts will require removal and disposal.

When decommissioned, verify the PCB content of fluorescent lamp ballasts as per the Environment Canada publication *Identification of Lamp Ballasts Containing PCBs*, 1991. Handle, store and dispose of PCB-containing ballasts.

Mould

Suspect mould should be remediated by a competent person, who is knowledgeable about the potential hazards of mould exposure. Remediation should be completed in accordance with industry guidelines.

Radioactive Sources

Most household detectors contain a very small amount of americium-241, a radioactive isotope. The slight amount of radiation that can be measured outside the unit does not pose any health risk. The average annual radiation dose from smoke detectors per person represents 0.01 percent of the dose they receive from natural background radiation. The safe encapsulation and low amount of radioactive material make these devices completely safe under all conditions, even during or after a fire.



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
 PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON

Table 1: Summary of Designated Substance and Hazardous Materials

Material	Sample ID	Description	Floor	Room	Estimated Quantity	Condition	Action	Photo
Asbestos	633560-BS-01A	Exterior window caulking - white	Exterior	Exterior	10-15 m (3 windows)	Good	ACTION 7	8
	633560-BS-03A	Exterior window caulking - white	Exterior	Exterior	50 m (12 windows)	Good	ACTION 7	9
	633560-BS-04A	Exterior window glazing compound - grey	Exterior	Exterior	50 m (12 windows)	Good	ACTION 7	10
	Ref: 633560-BS-10A-Floor Tile	9"x9" vinyl floor tile - white with green flecks	First	Foyer	10 sq. m	Good	ACTION 7	4
	633560-BS-10A-Floor Tile	9"x9" vinyl floor tile - white with green flecks	First	Foyer - closet	1 sq. m	Good	ACTION 7	4
	633560-BS-08A-Beige	Drywall joint-fill compound	First	Foyer, laundry room, washroom, laundry room, kitchen	250 - 275 sq. m	Good	ACTION 7	-
	Ref: 633560-BS-10A-Floor Tile	9"x9" vinyl floor tile - white with green flecks	First	Kitchen	10 sq. m	Good	ACTION 7	-
	633560-BS-15A	Paper-backing associated with vinyl sheet flooring - white	First	Kitchen	10 sq. m (1 sq. m poor)	Poor	ACTION 3	2
	633560-BS-16A	12"x12" vinyl floor tile - red	First	Kitchen	10 sq. m	Good	ACTION 7	7
	633560-BS-11A	12"x12" vinyl floor tile - beige pattern	First	Laundry room	10 sq. m	Good	ACTION 7	5
	Not sampled (presumed)	Mastic associated with 12"x12" vinyl floor tile - beige pattern	First	Laundry room	10 sq. m	Good	ACTION 7	5
	Ref: 633560-BS-08A-Beige	Drywall joint-fill compound	First	Laundry room	1 sq. m	Poor	ACTION 6	3
	633560-BS-14A-Floor Tile	12"x12" vinyl floor tile - beige	First	Living room	40 sq. m	Good	ACTION 7	6
	Not sampled (presumed)	Roofing materials	Roof	Roof	nq	Good	ACTION 7	11
	Not sampled (presumed)	Roof caulking	Roof	Roof	nq	Good	ACTION 7	11



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
 PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON

Table 1: Summary of Designated Substance and Hazardous Materials

Material	Sample ID	Description	Floor	Room	Estimated Quantity	Condition	Action	Photo
	Ref: 633560-BS-08A-Beige	Drywall joint-fill compound	Second	Hallway, washroom, bedroom 1, bedroom 2, bedroom 3	275 - 300 sq. m	Good	ACTION 7	-
Lead	633560-PS-01	Brown coloured paint	Exterior	Window	nq	Good	No action	13
	633560-PS-02	Grey coloured paint	First	Living room	nq	Good	No action	14
	633560-PS-03	White coloured paint	Second	Hallway	nq	Good	No action	15
Mercury	Not Sampled	Fluorescent light tubes	First	Laundry room	4 light tubes	Good	No action	-
Silica	Not Sampled	Concrete, masonry, stone, ceramic tile and ceiling tile	Throughout	Throughout	nq	Good	No action	-
Polychlorinated Biphenyls	Not Sampled	Fluorescent light fixtures with suspect PCB containing light ballasts	First	Laundry room	2	Good	No action	-
Mould	Not Sampled	Suspect mould on wood framing behind wood panel	Second	Bedroom 3	1 sq. m	Poor	Determine source and remove	16
Radioactive Sources	Not Sampled	Smoke alarms	Throughout	Throughout	nq	Good	No action	-
<p><u>Asbestos Action Levels</u></p> <p>ACTION 1 Immediate clean-up of debris that is likely to be disturbed</p> <p>ACTION 2 Entry into areas with asbestos-containing material debris requires intermediate risk precautions</p> <p>ACTION 3 Asbestos-containing material removal required for compliance</p> <p>ACTION 4 Access into areas where asbestos-containing material is present and likely to be disturbed by access requires intermediate risk precautions</p> <p>ACTION 5 Proactive asbestos-containing material removal</p> <p>ACTION 6 Asbestos-containing material repair</p> <p>ACTION 7 Routine surveillance</p>							<p><u>Legend</u></p> <p>nq – not quantified</p> <p>sq. m – square meter</p> <p>Ref – reference</p> <p>BS – bulk sample</p>	



1.0 INTRODUCTION

Stantec Consulting Ltd. (Stantec) was engaged by Public Services and Procurement Canada (PSPC) on behalf of Parks Canada Agency (PCA) to conduct a designated substances and hazardous materials survey of the house at Property Identification Number (PIN) 633560 located at 1968 Woodview Avenue in Toronto, Ontario.

The purpose of the survey was to identify actual and potential designated substances and hazardous building materials and update the asbestos inventory in the PCA asbestos management plan for the Rouge National Urban Park (RNUP). The work was carried out in accordance with the requirements of the *Canada Labour Code Part II, Canada Occupational Health and Safety Regulations, National Joint Council Occupational Health and Safety Directive, PCA Asbestos Management Standard & Procedures* (December 2018) and provincial regulations including Ontario Regulation 278/05 Designated Substance - Asbestos on Construction Projects and in Buildings and Repair Operations (O. Reg. 278/05). The designated substances assessment list includes those substances designated under the *Ontario Occupational Health and Safety Act* and included (but were not limited to) asbestos, lead, mercury and silica as the most likely to be present. In addition to designated substances, the hazardous building materials considered in this assessment included: polychlorinated biphenyls (PCBs); halocarbons; urea-formaldehyde foam insulation (UFFI); mould; fuel oil and/or waste oil storage; chemical storage; and radioactive materials.

The site work was conducted by Will Madden-Macavelia on November 7, 2019.

Parks Canada Agency commissioned this assessment as a measure of diligence in maintaining compliance with the aforementioned legislative framework. Following the identification of asbestos-containing materials (ACMs) or presumed asbestos-containing material (PACMs) the asbestos inventory will be updated in the PCA asbestos management plan for the RNUP.



2.0 SCOPE

The scope of work for this assessment involved the following:

- A review of existing information, including previous assessment and/or abatement documentation and discussions with site personnel, where available
- A visual assessment of readily accessible areas for the presence of designated substances and hazardous building materials
- The collection of representative bulk samples from building materials suspected of containing asbestos fibers
- The collection of paint chip samples for the determination of the lead content in paint finishes
- Submission of samples collected for laboratory analysis
- Evaluation and interpretation of field findings and previous analytical results to develop conclusions and recommendations pertaining to designated substances and hazardous building materials identified to be present
- Preparation of a report summarizing the field finding, laboratory results and providing recommendations for the management of designated substances and hazardous materials



3.0 DESIGNATED SUBSTANCES AND HAZARDOUS BUILDING MATERIALS ASSESSMENT

The results of the assessment for each of the considered designated substances and hazardous materials are provided in the following sub-sections. Refer to **Appendix A** for the completed and detailed regulatory framework and relevant legislation with respect to designated substances and hazardous building materials.

3.1 FACILITY DESCRIPTION

The house is located at 1968 Woodview Avenue in Toronto, Ontario and consists of a two-story building with a crawlspace. The reported construction date of the house is unknown. The typical structural components and finishes associated with this building consist of brick exterior walls, various types of flooring including wood, vinyl sheet flooring, vinyl floor tile, ceramic tile, carpet and laminate flooring and interior concrete block and drywall walls with drywall ceilings.

3.2 DOCUMENT REVIEW

Stantec was not provided with previous reports for review for this property.

3.3 PROJECT-SPECIFIC LIMITATIONS

The assessment was limited to the house only. The following areas were not accessed, for the reasons indicated:

- Crawl space (no access)
- Roof (no access – health and safety concerns due to height of materials). The roof was flat and not visible from the ground.

3.4 ASBESTOS

3.4.1 Methodology

A visual assessment of accessible areas was undertaken in order to check for the presence and condition of materials suspected of containing asbestos. Locations to collect discrete bulk asbestos samples of suspect building materials were identified. Samples of representative materials were then collected at these locations.

The PCA *Asbestos Management Standard & Procedures* (December 2018) was used as the basis for the criteria that was applied in evaluating the presence of ACMs and PACMs, where applicable.

The sampling of representative suspect ACMs involved identifying homogeneous areas of suspect materials and collection of three to seven representative samples depending on the size of area occupied



by the identified homogeneous material. O. Reg. 278/05 provides guidelines on bulk sampling of suspect ACMs based on type of material and quantity; the requirements are summarized in Table 2 below. Samples of suspect ACMs were collected using hand tools and placed in clearly labelled plastic bags. Labels identify the project specific sample ID, a description of the material sampled, and the specific location and date the sample was collected. A laboratory chain of custody was completed, and cross referenced with the labels on the sample bags for quality assurance purposes prior to submitting the samples for analysis.

Table 2: Summary of O. Reg 278/05 Sampling Requirements

Type of Material	Size of Area of Homogeneous Material	Minimum Number of Bulk Material Samples to be Collected
Surfacing material, including without limitation material that is applied to surfaces by spraying, by troweling or otherwise, such as acoustical plaster on ceilings and fireproofing materials on structural members	Less than 90 square metres	3
	90 or more square metres, but less than 450 square metres	5
	450 or more square metres	7
Thermal insulation, except as described in item 3	Any size	3
Thermal insulation patch	Less than 2 linear metres or 0.5 square metres	1
Other material	Any size	3

Samples of suspect ACMs from various building materials were collected and submitted to EMSL Canada Inc. (EMSL), located in Mississauga, ON for analysis using Polarized Light Microscopy (PLM) with dispersion staining and Transmission Electron Microscopy (TEM) analysis for vinyl floor tile. The analysis was conducted following the U.S. EPA/600/R-93/116 Method. EMSL is certified under the National Voluntary Laboratory Accreditation Program (NVLAP) to perform asbestos analysis of bulk samples. ACMs in Ontario are defined as a material that contains 0.5 per cent or more asbestos by dry weight.

A positive stop option is used during the analysis of samples. Multiple samples of visually similar material are collected and submitted for laboratory analysis. Once a sample within the set is identified to contain asbestos, further analysis of the subsequent samples is deemed to be unnecessary and not conducted and they are assumed to contain asbestos.

3.4.2 Findings

3.4.2.1 Asbestos-Containing Materials

Samples of 72 suspect asbestos-containing building materials were collected. A summary list of the bulk samples that were collected including a description of the material, sampling location, type of analysis and laboratory test results is provided in **Appendix D**. A copy of the laboratory Certificate of Analysis is provided in **Appendix E**.



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON

Building materials suspected to be asbestos containing have been identified to be ACMs by laboratory analysis. A material is considered to be asbestos-containing if it has an asbestos content of 0.5% or more as defined by O. Reg. 278/05.

Suspect asbestos-containing materials were observed to be present but not sampled and are listed as PACMs. PACMs are known to have been manufactured with asbestos and should be presumed to be asbestos-containing unless proven otherwise by laboratory analysis. Presumed asbestos-containing mastic associated with 12"x12" vinyl floor tile – beige pattern was not sampled to avoid causing significant damage to the vinyl floor tiles. Roofing materials and roof caulking was not sampled due to health and safety concerns related to the height of the materials.

A summary of occurrences of ACMs and PACMs is provided in **Table 3** below.

Paper backing associated with vinyl sheet flooring – white was observed to be in poor condition (paper-backing exposed) within the first-floor kitchen. Drywall joint-fill compound was observed to be in poor condition (punched in) within the first-floor laundry room. The remaining materials were observed to be in good condition.

Photographs of the identified ACMs and PACMs including damaged materials are provided in **Appendix B**. Floor plans showing the locations of ACMs, PACMs and bulk samples are provided in **Appendix C**. The evaluation criterion for assessing ACMs and PACMs is provided in **Appendix H**.



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
 PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON

Table 3: Asbestos-Containing Material Occurrences

Level	Room	Specific Location	Material Description	Estimated Quantity	Sample Number	Asbestos Content	Friable ?	Access	Condition	Action Level	Photo
Exterior	Exterior	Crawlspace windows	Exterior window caulking - white	10-15 m (3 windows)	633560-BS-01A	3.0% chrysotile	No	A	Good	ACTION 7	8
Exterior	Exterior	Windows	Exterior window caulking - white	50 m (12 windows)	633560-BS-03A	1.1% chrysotile	No	A	Good	ACTION 7	9
Exterior	Exterior	Windows	Exterior window glazing compound - grey	50 m (12 windows)	633560-BS-04A	2.1% chrysotile	No	A	Good	ACTION 7	10
First	Foyer	Beneath ceramic tile	9"x9" vinyl floor tile - white with green flecks	10 sq. m	Ref: 633560-BS-10A-Floor Tile	0.70% chrysotile	No	D	Good	ACTION 7	4
First	Foyer - closet	Flooring	9"x9" vinyl floor tile - white with green flecks	1 sq. m	633560-BS-10A-Floor Tile	0.70% chrysotile	No	A	Good	ACTION 7	4
First	Foyer, laundry room, washroom, laundry room, kitchen	Walls and ceilings	Drywall joint-fill compound	250 - 275 sq. m	633560-BS-08A-Beige	2% chrysotile	No	A	Good	ACTION 7	-
First	Kitchen	Beneath laminate, vinyl sheet flooring and 12"x12" vinyl floor tile - red	9"x9" vinyl floor tile - white with green flecks	10 sq. m	Ref: 633560-BS-10A-Floor Tile	0.70% chrysotile	No	D	Good	ACTION 7	-
First	Kitchen	Beneath laminate flooring	Paper-backing associated with vinyl sheet flooring - white	10 sq. m (1 sq. m poor)	633560-BS-15A	35% chrysotile	No	D	Poor	ACTION 3	2
First	Kitchen	Beneath laminate and vinyl sheet flooring	12"x12" vinyl floor tile - red	10 sq. m	633560-BS-16A	1.0% chrysotile	No	D	Good	ACTION 7	7
First	Laundry room	Beneath laminate flooring	12"x12" vinyl floor tile - beige pattern	10 sq. m	633560-BS-11A	2.2% chrysotile	No	D	Good	ACTION 7	5
First	Laundry room	Beneath laminate flooring	Mastic associated with 12"x12" vinyl floor tile - beige pattern	10 sq. m	Not sampled (presumed)	Presumed	No	D	Good	ACTION 7	5



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
 PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON

Table 3: Asbestos-Containing Material Occurrences

Level	Room	Specific Location	Material Description	Estimated Quantity	Sample Number	Asbestos Content	Friable ?	Access	Condition	Action Level	Photo
First	Laundry room	Wall	Drywall joint-fill compound	1 sq. m	Ref: 633560-BS-08A-Beige	2% chrysotile	No	A	Poor	ACTION 6	3
First	Living room	Beneath laminate flooring	12"x12" vinyl floor tile - beige	40 sq. m	633560-BS-14A-Floor Tile	3.9% chrysotile	No	D	Good	ACTION 7	6
Roof	Roof	Roof	Roofing materials	nq	Not sampled (presumed)	Presumed	No	C	Good	ACTION 7	11
Roof	Roof	Roof	Roof caulking	nq	Not sampled (presumed)	Presumed	No	C	Good	ACTION 7	11
Second	Hallway, washroom, bedroom 1, bedroom 2, bedroom 3	Walls and ceilings	Drywall joint-fill compound	275 - 300 sq. m	Ref: 633560-BS-08A-Beige	2% chrysotile	No	A	Good	ACTION 7	-
<p><u>Asbestos Actions</u></p> <p>ACTION 1 Immediate clean-up of debris that is likely to be disturbed</p> <p>ACTION 2 Entry into areas with asbestos-containing material debris requires intermediate risk precautions</p> <p>ACTION 3 Asbestos-containing material removal required for compliance</p> <p>ACTION 4 Access into areas where asbestos-containing material is present and likely to be disturbed by access requires intermediate risk precautions</p> <p>ACTION 5 Proactive asbestos-containing material removal</p> <p>ACTION 6 Asbestos-containing material repair</p> <p>ACTION 7 Routine surveillance</p>					<p><u>Asbestos Accessibility</u></p> <p>Access A Areas of the building within reach (from floor level) of all building users</p> <p>Access B Frequently entered maintenance areas within reach of maintenance staff, without the need for a ladder</p> <p>Access C Areas of the building above 8'0" where use of a ladder is required to reach the asbestos-containing material</p> <p>Access D Areas of the building behind inaccessible solid ceiling systems, walls, or mechanical equipment, etc.</p>				<p><u>Legend</u></p> <p>nq – not quantified</p> <p>sq. m – square meter</p> <p>Ref – reference</p> <p>BS – bulk sample</p>		



3.4.2.2 Potential for Vermiculite Insulation

It should be noted that various walls of the subject building were comprised of masonry (concrete) blocks. Asbestos-contaminated vermiculite was historically used as insulating material in masonry block or brick walls. To assess for this potential ACM, destructive sampling is required, which was not conducted as part of this assessment. Although various holes, breaches and cracks were observed, and no vermiculite was present, the presence of this potential ACM cannot be ruled out without destructive testing.

3.4.2.3 Non-Asbestos-Containing Materials

A summary list of the bulk samples collected during this assessment and confirmed to be non-ACMs by laboratory analysis is provided in **Appendix D**.

3.4.3 Recommendations

The disturbance of ACMs on construction and demolition projects is governed by the Occupational Health and Safety Regulations, PCA AMP for RNUP, PSPC *Asbestos Management Standard (June 5, 2017, updated October 24, 2018)*, and O. Reg. 278/05. These regulations classify asbestos disturbances as Type 1 (Low Risk), Type 2 (Moderate Risk) and Type 3 (High Risk) and define the precautionary measures and handling and disposal precautions for each type of operation.

Based on the visual assessment and laboratory analysis, ACMs and PACMs have been identified. Stantec recommends the following with regards to meeting the regulatory requirements:

- Damaged asbestos-containing paper-backing associated with vinyl sheet flooring – white in the first-floor kitchen should be removed following Type 2 (Moderate Risk) abatement operations (Action 3).
- Damaged asbestos-containing drywall joint-fill compound in the first-floor laundry room should be repaired following Type 1 (Low Risk) abatement operations (Action 6).
- Asbestos-containing caulking, drywall joint-fill compound and vinyl floor tiles can be left in place, as the materials were observed to be in good condition. No further abatement actions are required.
- Presumed asbestos-containing materials can be left in place, as the materials were observed to be in good condition. If the material is to be disturbed, it should be sampled to confirm if asbestos is present.
- On an annual basis, the ACM and PACM inventory should be updated through a reassessment based primarily on change in condition and quantity (Action 7).
- Prior to renovation and/or demolition activities, undertake a pre-construction designated substances and hazardous building materials assessment and testing of suspect ACMs and/or PACMs that may be impacted to determine their asbestos content. Confirmed asbestos materials should be handled & *Procedures* (December 2018).
- If masonry block walls are to be demolished or impacted, and these walls have not been checked for the presence of vermiculite insulation, destructive action should be preceded by assessment for vermiculite. If filled with vermiculite insulation, this material should be treated as an ACM until testing can verify the asbestos content.
- Should a material suspected to contain asbestos fibres become uncovered during the project, all work in the areas that may disturb the material should be stopped. Samples of the suspect material should be submitted for laboratory analysis to determine if asbestos fibres are present. Confirmed asbestos materials should be handled in accordance with the PCA *Asbestos Management Standard & Procedures* (December 2018).



- The report findings should be added to the Asbestos Management Plan.

The following are Type 1 (Low Risk) operations:

- Installing or removing non-friable asbestos-containing material other than ceiling tiles if the material is installed or removed without being broken, cut, drilled, abraded, ground, sanded or vibrated.
- Breaking, cutting, drilling, abrading, grinding, sanding, or vibrating of non-friable materials if the work is wetted to control the spread of dust and done by means of non-powered hand tools.
- Removing less than one square metre of drywall in which joint-filling compounds that are asbestos-containing material have been used.

The following are Type 2 (Moderate Risk) operations:

- Removing one square metre or more of drywall in which joint filling compounds that are asbestos-containing have been used.
- The removal of one square metre or less of friable asbestos-containing material during the repair, alteration, maintenance or demolition of all or part of machinery or equipment or a building, aircraft, locomotive, railway car, vehicle or ship
- Breaking, cutting, drilling, abrading, grinding, sanding or vibrating non-friable asbestos-containing material if,
 - The material is not wetted to control the spread of dust or fibers
 - The work is done only by means of non-powered hand-held tools
- Breaking, cutting, drilling, abrading, grinding, sanding or vibrating non-friable asbestos-containing material if the work is done by means of power tools that are attached to dust-collecting devices equipped with HEPA filters.

The following are Type 3 (High Risk) operations:

- The removal or disturbance of more than one square metre of friable asbestos-containing material during the repair, alteration, maintenance or demolition of all or part of a building, aircraft, ship, locomotive, railway car or vehicle or any machinery or equipment.
- Breaking, cutting, drilling, abrading, grinding, sanding or vibrating non-friable asbestos-containing material, if the work is done by means of power tools that are not attached to dust-collecting devices equipped with HEPA filters.

3.5 LEAD

3.5.1 Methodology

A visual assessment of accessible areas was undertaken in order to check for the presence of materials that may contain lead. These materials included paint applications, wiring and plumbing etc.

Samples of visibly different paint applications were collected using hand tools and placed in clearly labelled plastic bags. Labels identify the project specific sample ID, a description of the material sampled, and the specific location and date the sample was collected. The sampling of paint applications involved the collection of paint chip samples of paint layers to the substrate. A minimum volume of 5 cc or 1 teaspoon of paint chips was typically collected. Wherever necessary and possible, paint was separated from any backing material such as paper, concrete or wood and placed in a sealed clearly labelled plastic bag.



Samples of suspect paint chips were collected. A laboratory chain of custody was completed, and cross referenced with the labels on the sample bags for quality assurance purposes prior to submitting the samples for analysis

Representative paint samples were collected and submitted to EMSL Canada Inc. (EMSL) located in Mississauga, Ontario for lead content analysis by Flame Atomic Absorption Spectrophotometry, following US EPA Method No. 7420.

3.5.2 Findings

A summary list of the samples collected including a description of the samples, sampling locations and laboratory analytical results is provided in **Appendix F**. A copy of the laboratory Certificate of Analysis for the paint chip testing is included in **Appendix G**. The sampling locations are indicated on the floor plans provided in **Appendix C**.

Four samples of major paint applications were collected in the form of paint chip samples and submitted to EMSL for lead content analysis.

Based on the laboratory results, the following paint samples contain lead in concentrations that are >90 ppm. PCA uses the *Surfacing Coating Materials Regulation SOR/2016-193* limit of 90 ppm as the criteria to manage paint applications.

Table 4: Lead-Containing Paint Samples

Sample Number	Description	Room	Specific Location	Lead Content	Condition	Photo
633560-PS-01	Brown coloured paint	Window	Frame	1,200 ppm	Poor	13
633560-PS-02	Grey coloured paint	Living room	Drywall wall	140 ppm	Good	14
633560-PS-03	White coloured paint	Hallway	Drywall wall	170 ppm	Good	15

Brown coloured paint on the exterior window frames was observed to be in poor condition (2 m² flaking). The remaining paint applications were observed to be in good condition.

Lead may also be present in the following materials:

- Other coating applications not tested
- Older electrical wiring materials and sheathing
- Solder used on domestic water lines
- Solder used in bell fittings for cast iron pipes
- Solder used in electrical equipment
- Ceramic tile glaze
- Vent and pipe flashings



3.5.3 Recommendations

The Ministry of Labour (MOL) guideline *Lead on Construction Projects*, dated April 2011 and the Environmental abatement Council of Ontario (EACO) guideline *Lead Guideline for Construction, Maintenance or Repair*, dated October 2014 sets out requirements when disturbing any lead-containing paints. The document outlines the following with respect to lead: Legal Requirements, Health Effects, Controlling the Lead Hazard, Classification on Work (Type 1/Class 1, Type 2/Class 2, Type 3/Class 3) and Measures and Procedures for Working with Lead.

Damaged paint on the exterior window frames should be cleaned up. Loose paint should be removed following lead precautions and repainted.

The safety precautions to be followed when removing lead based paint are determined by the classification level of the operation and associated risk.

Minimum lead precautions are to be followed when performing the following Class 1 operations on lead-containing paint applications.

- Removal of lead-containing coatings with a chemical gel or paste and fibrous laminated cloth wrap
- Removal of lead-containing coatings or materials using a power tool with an effective dust collection system equipped with a HEPA filter.
- Removal of lead-containing coatings or materials with non-powered hand tool, other than manual scraping and sanding.

Moderate lead precautions are to be followed when performing the following Class 2 operations on lead-containing paint applications.

- Removal of lead-containing paint by scraping or sanding using non-powered hand tools.

Maximum lead precautions are to be followed when performing the following Class 3 operations on lead-containing paint and lead containing paint applications.

- Removal of lead-containing paint using power tools without an effective dust collection system equipped with HEPA filter.
- Abrasive blasting of lead-containing paint.

The work tasks required and the ways in which lead based paints will be impacted will determine the appropriate respirators, measures and procedures that should be followed to protect workers from lead exposure, and protect the natural environment including soils, water, and other adjacent surfaces. This is to be determined by the Contractor through their own Risk Assessment.

Actions that will disturb lead-containing materials, including paints and materials are to be conducted in such a manner to keep airborne exposure to lead dust to less than limit in O. Reg. 490/09 respecting Designated Substances - Lead made under the Occupational Health and Safety Act as amended by O. Reg. 148/12 and O. Reg. 149/12.



Prior to removal from the site and disposal, materials containing lead should be subject to toxicity characteristic leaching procedure (TCLP) testing to determine toxicity with respect to lead prior to disposal in accordance with R.R.O. 1990, Regulation 347 General - Waste Management, as amended (R.R.O. 1990, Reg. 347) under the Environmental Protection Act (EPA). If TCLP testing is not completed, contractor to assume paint to be disposed of as lead waste.

3.6 MERCURY

3.6.1 Methodology

A visual assessment for the presence of mercury-containing equipment was conducted.

3.6.2 Findings

Mercury is likely to be present in four fluorescent light tubes in the first-floor laundry room. Mercury may also be present in paints and adhesives but is not expected to pose a hazard.

3.6.3 Recommendations

Mercury vapour within light fixtures or other equipment such as thermostats poses no risk to workers or occupants provided the mercury containers remain intact and undisturbed. Complete removal of mercury-containing equipment is required prior to demolition activities that may disturb the equipment. Prior to demolition work or renovation, the light tubes and thermostats must be removed and stored in a safe, secure location or disposed of following the requirements of R.R.O. 1990, Reg. 347 under the EPA.

Recommendations outlined in 3.5.3 of this report, regarding the handling of lead, will also be sufficient for the handling of mercury in paints and adhesives.

3.7 SILICA

3.7.1 Methodology

An assessment for the presence of silica was conducted. The presence of silica in building materials such as concrete, masonry, stone, terrazzo, refractory brick, ceramic tile, ceiling tile etc. was noted.

3.7.2 Findings

Silica is expected to be present in ceramic tiles, vinyl floor tiles, concrete and masonry block and interior wall finishes observed in the house.

3.7.3 Recommendations

The Guideline: Silica on Construction Projects issued by the MOL, dated April 2011 outlines: legal requirements, health effects, controlling the silica hazard, classification on work and measures, and



procedures for working with silica and should be followed during disturbance of silica-containing materials.

The Guideline defines the classification of work. It is the classification of the work that determines the appropriate respirators, measures and procedures that should be followed to protect the worker from silica exposure. In the guideline, silica-containing construction operations are classified into three groups, Type 1, Type 2, and Type 3 operations, and can be thought of as being of low, medium, and high risk. From Type 1 to Type 3 operations, the corresponding respirator, and measures and procedures become increasingly stringent.

Precautions should be taken as required during renovation projects impacting materials expected to contain silica (i.e., coring through concrete slabs, demolition of masonry or concrete units, ceramic tiles, brick, etc.) where dust may be generated. Whenever practical changing how a process is performed to lower the silica exposure is preferable. Wet methods reduce dust and should be used whenever practical, particularly in cutting, grinding, and drilling operations.

Silica is included in O. Reg. 490/09 and the regulation provides information on the application of the regulation as well as allowable exposure levels, where the maximum TWA for respirable airborne silica (cristobalite) is 0.05 mg/m³ and 0.10 mg/m³ for quartz/Tripoli. However, the more stringent level of 0.025 mg/m³ for respirable crystalline silica (quartz, cristobalite) applies as noted in the ACGIH 2018 TLVs for Chemical Substances and Physical Agents. The assessment and control program and medical surveillance requirements are for non-construction projects as defined in O. Reg. 490/09.

3.8 POLYCHLORINATED BIPHENYLS

3.8.1 Methodology

A visual review for the presence of PCBs in electrical equipment is completed. Equipment that is generally suspected of containing PCBs includes lamp ballasts, transformers, hydraulic systems, compressors, switchgear and capacitors.

3.8.2 Findings

PCBs may be present in the light ballasts of the two light fixtures observed in the first-floor laundry room. As the ballasts were energized, they could not be inspected at the time of the assessment for health and safety reasons.

Although they may also be present in other items in limited amounts (e.g. plastics, molded rubber parts, applied dried paints, coatings or sealants, caulking, adhesives, paper, sound-deadening materials, insulation, or felt and fabric products such as gaskets), PCBs are not expected to be present in those materials in concentrations that would necessitate the requirement for PCB-specific handling procedures, separate removal and/or disposal considerations for renovation or demolition. As such, these items were not considered in our assessment.



3.8.3 Recommendations

Fluorescent lamp ballasts that may contain PCBs can be managed in place, where these items are operating and in good condition. No further action is currently required until such time that renovation or demolition activities are to be conducted, or until 2025, when PCB-containing ballasts will require removal and disposal.

When decommissioned, verify the PCB content of fluorescent lamp ballasts as per the Environment Canada publication *Identification of Lamp Ballasts Containing PCBs*, 1991. Handle, store and dispose of PCB-containing ballasts in accordance with Federal Regulation SOR/2008-273, under CEPA and R.R.O. 1990, Reg. 362.

Should a material suspected to contain PCBs become uncovered during demolition activities (i.e., dielectric fluids, hydraulic fluids), all work in the areas that may disturb the material should be stopped. Samples of the suspect material should be submitted for laboratory analysis to determine if PCBs are present. Confirmed PCBs should be handled in accordance with Federal Regulation SOR/2008-273 and R.R.O. 1990, Reg. 362, under the EPA.

3.9 HALOCARBONS

3.9.1 Methodology

An assessment for equipment likely to contain halocarbons was completed. Information on the type of equipment, manufacturer and type and quantity of refrigerants was recorded, where available.

3.9.2 Findings

Building related cooling and refrigeration equipment containing halocarbons was not observed.

3.9.3 Recommendations

As evidence of suspect halocarbon-containing equipment was not observed, no recommendations have been provided.

3.10 MOULD

3.10.1 Methodology

An assessment for the potential presence of mould was completed. This involved a visual assessment of accessible surfaces for obvious evidence of mould, moisture or water damage.

3.10.2 Findings

Suspect mould and water staining was observed as follows:



Table 5: Mould and Water Damage Findings

Description	Location	Quantity	Photo
Suspect mould on wood framing behind wood panel	Second floor - bedroom 3	1 m ²	16

3.10.3 Recommendations

Suspect mould and mould impacted building materials should be remediated in accordance with the documents entitled

- *CCA Mould Guidelines for the Canadian Construction Industry*, dated 2004
- *EACO Mould Abatement Guidelines, Edition 3*, dated 2015

Remediation should be done by a competent person, who is knowledgeable of potential hazards of mould exposure, following remediation precautions.

3.11 UREA FORMALDEHYDE FOAM INSULATION

3.11.1 Methodology

An assessment for the potential presence of UFFI was completed. This involved the assessment of exterior and interior walls for evidence of repaired openings (i.e., nozzle holes) made to facilitate the installation of the insulation. Wherever possible, an assessment of wall cavities through existing openings was made.

3.11.2 Findings

Evidence of the application of UFFI was not observed to be present.

3.11.3 Recommendations

As evidence of the application of UFFI was not observed, no recommendations have been provided.

3.12 OTHER DESIGNATED SUBSTANCES: ACRYLONITRILE, ARSENIC, BENZENE, COKE OVEN EMISSIONS, ETHYLENE OXIDES, ISOCYANATE, VINYL CHLORIDE

3.12.1 Methodology

Designated substances including acrylonitrile, arsenic, benzene, coke oven emissions, ethylene oxides, isocyanates, and vinyl chloride are not typically a concern in building materials, and therefore these substances were not investigated. However, some common sources are shown below.

Acrylonitrile may be present in stable form in paints and adhesives.



Arsenic or arsenic compounds may be present in paints and adhesives.

Benzene as a constituent of hydrocarbon-based mixtures and is present in a stable form in roofing materials, paints and adhesives. Benzene in these forms is not expected to be of a worker exposure concern.

Uncured Isocyanate may be present in paint finishes, varnishes, polyurethane plastics, synthetic rubbers, foams and adhesives.

Vinyl chloride (monomer) is generally likely to be present in stable form within the PVC piping and conduits, where applicable.

3.13 RADIOACTIVE SOURCES

3.13.1 Methodology

There are two primary technologies used in smoke detectors. One type uses a photoelectric sensor to detect the change in light level caused by smoke. The other type, ionizing smoke detectors, use a small amount of radioactive material to sense smoke. Ionizing smoke detectors are used in Canada because they are best at detecting quick burning fires, such as many of the fires which occur in North American buildings, which contain significant amounts of wood.

An assessment for the presence of smoke detectors was completed.

3.13.2 Findings

Smoke detectors were observed within the house at the time of the assessment.

3.13.3 Recommendations

Most household detectors contain a very small amount of americium-241, a radioactive isotope. The slight amount of radiation that can be measured outside the unit does not pose any health risk. The average annual radiation dose from smoke detectors per person represents 0.01 percent of the dose they receive from natural background radiation. The safe encapsulation and low amount of radioactive material make these devices completely safe under all conditions, even during or after a fire.

3.14 FUEL OIL AND/OR WASTE OIL STORAGE AND CHEMICAL STORAGE

3.14.1 Methodology

An assessment for the presence of fuel oil and or waste oil storage and chemical storage was completed.



3.14.2 Findings

Evidence of fuel oil and/or waste oil storage and chemical storage was not observed.

3.14.3 Recommendations

As evidence of fuel and oils was not observed, no recommendations have been provided.

3.15 LIMITATIONS

This report reflects observations made within areas accessed and results of analyses performed on specific materials sampled, as indicated herein. Analytical results reflect the sampled materials at the specific sampling locations.

3.15.1 Physical and Sampling Limitations

Sampling is exclusive to suspected ACMs and suspected lead-containing paints (LCPs) only. The assessment for the presence of other designated substances and hazardous building materials is visual in nature and is conducted pertaining to readily visible surfaces within accessible spaces only. Concealed spaces are assessed via existing access panels, where present. Interior and exterior finishes, solid ceilings, walls, flooring and structural elements are not removed to access concealed areas.

Due to limitations on the agreed to scope of work for this project, as well as physical limitations in accessing concealed areas and limitations associated with working in occupied/operational spaces. There are specific limitations to the information that can be provided to each hazardous building material considered in this assessment. As outlined below, the presence and the asbestos content of some building materials can neither be confirmed nor denied.

Building materials that may contain asbestos but are generally not accessible for sampling include, but are not limited to the following:

- Sub-grade materials (e.g., asbestos cement drainage pipe)
- Flooring material concealed beneath carpeting, ceramic tile, brickwork, hardwood flooring, and/or concealed beneath existing sub-floors
- Insulation material present inside walls (e.g., suspected asbestos-containing vermiculite insulation inside concrete block and/or brick walls)
- Drywall and/or wall plaster and associated finish materials concealed behind new and/or additional walls
- Woven tape inside duct connection joints
- Mechanical (e.g., piping and ducting) insulation within wall cavities, crawl spaces tunnels or other concealed or confined spaces
- Insulation materials inside building materials, including fire doors and window frames
- Heating, ventilation and air conditioning (HVAC) units mechanical inner linings and/or inner ducting insulation
- Heat protection and insulating materials inside mechanical and electrical installations and light fixtures



Samples of paint applications suspected to contain lead are collected from surfaces of major paint applications where visually different paint colours and/or types are identified. Although the surfaces where samples are collected may be covered with more than one coat of paint, the paint samples are described by the surface (visible) colour only. Attempts are made to represent all layers of paint in the samples collected. As analytical results are referenced to the surface paint colour only, the lead content of all painted surfaces similar to that represented by the surface paint colour will be presumed to be the same, regardless of differing sub surface paints, if any.>>

The presence of mercury or mercury-containing equipment in inaccessible areas or as internal parts of HVAC mechanisms or other equipment, are not assessed.

Due to height restrictions and the risk of electrical shock in handling operational light fixtures, ballasts present in fixtures observed are not inspected for PCB labels or other PCB identifiers. Conclusions and recommendations regarding the presence of PCBs are based on limited observations and information provided regarding lighting renovations and is presented to provide guidance regarding the likelihood that PCB-containing equipment is or is not present. The exact extent and/or number of fluorescent lamp ballasts containing PCBs, if any, are not commented on.>>

The assessment is limited to a visual review in accessed areas of readily accessible cooling and refrigeration equipment which could contain halocarbons; testing is not conducted. Equipment or materials that are not included as part of this assessment but that may contain halocarbons include: flexible plastic foam or rigid insulation foam, solvents, aerosol spray propellants and fire extinguishing equipment.

Visual assessment for the presence of suspected visible mould and/or suitable conditions for mould growth (e.g., moist and/or water-stained building materials) is conducted. The conclusions made in this report provide description(s) of the potential source(s) of moisture that may have led to suitable conditions for mould growth, only in those cases where potential source(s) of moisture were identified. The visual assessment does not include an intrusive assessment. These conclusions will not necessarily identify all sources of moisture leading to suitable conditions for mould growth within the impacted area(s). This assessment does not constitute a building envelope/building systems assessment, which would include an intrusive investigation to assess the internal condition, potential moisture sources, and expected remaining service life of the various components and systems comprising the envelope of a building.

In general, the assessment for the presence of other designated substances and hazardous building materials is visual in nature and is conducted pertaining to readily visible surfaces within accessible accessed spaces only. The potential presence of hazardous building materials in inaccessible areas which are not assessed includes, but is not limited to: ceiling spaces, wall cavities, crawl spaces, and buried materials.



4.0 CLOSURE

This report has been prepared for the sole benefit of the Parks Canada Agency and Public Services and Procurement Canada.

Any use which a third party makes of this report, or any reliance on decisions based on it, is the responsibility of such third parties. Stantec Consulting Ltd. accepts no responsibility for damages, if any, suffered by any third party as a result of decisions made or actions based on this report.

The information and conclusions contained in this report are based upon work undertaken by trained professionals and technical staff in accordance with generally accepted engineering and scientific practices current at the time the work was performed. Conclusions presented in this report should not be construed as legal advice.

The conclusions presented in this report represent the best technical judgment of Stantec Consulting Ltd. based on the data obtained from the work.

The conclusions are based on the site conditions encountered by Stantec Consulting Ltd. at the time the work was performed at the specific assessment and/or sampling locations and can only be extrapolated to an undefined limited area around these locations. The extent of the limited area depends on building construction and conditions, weather, building usage and other factors. Due to the nature of the investigation and the limited data available, Stantec Consulting Ltd. cannot warrant against undiscovered environmental liabilities.

If any conditions become apparent that differ significantly from our understanding of conditions as presented in this report, we request that we be notified immediately to reassess the conclusions provided herein.



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON

We trust that the above is satisfactory for your purposes at this time. Should you have any questions or concerns, or require additional information, please do not hesitate to contact the Stantec Project Manager at your convenience.

This report was prepared by Will Madden-Macavelia and reviewed by Linda Fleet and Martin Ling.

Regards,

STANTEC CONSULTING LTD.

Linda Fleet
Project Manager
Phone: 705-719-1813
linda.fleet@stantec.com

Martin Ling
Associate
Phone: 905-415-6386
martin.ling@stantec.com

WMM/LF/ML/de

nplr \\cd1215-f01\work_group\01221\active\122151011\31 - reports\633560\final\122151011_633560_rpt_2020mar18_mup_final.docx



APPENDICES

Appendix A REGULATORY FRAMEWORK



DESIGNATED SUBSTANCES

Asbestos

Asbestos is typically found in plaster, mechanical insulation, gaskets, thermal insulation on pipes, refractory material, roofing felts, floor tiles, ceiling tiles and parging, heat resistant panels, incandescent light fixture reflector plates, and any other material requiring a high degree of durability or thermal resistance. The common use of potential (breakable by hand) asbestos-containing materials (ACMs) in construction ceased voluntarily in the mid-1970s; however, the spray application of asbestos-containing fireproofing was not prohibited until 1986.

Asbestos-containing materials are grouped into two classifications, friable and non-friable materials. Friable ACMs are those that can easily be crumbled or broken apart by mere hand pressure. When these materials break apart asbestos fibers are then released into the atmosphere. Non-friable ACMs or “manufactured products” are materials that by the nature of their manufacturing/construction do not readily allow the release of asbestos fibers. These materials should not be cut or shaped with power tools, since this procedure may allow for the release of the asbestos fibers. Some materials or “manufactured products”, such as plaster, drywall and ceiling tiles that are considered to be non-friable in an undisturbed state can become friable when damaged or disturbed. These are often referred to as “potentially” friable materials.

Canada Labour Code (Part II) defines the requirements for an asbestos exposure control plan to be developed before undertaking any work activities that involves asbestos-containing materials. The Canada Labour Code (*Part II*) also stipulate the requirements for air monitoring during removal procedures.

Ontario Regulation 490/09 Designated Substances (O. Reg. 490/09), as amended, under the Ontario Occupational Health and Safety Act (OHSA) primarily regulates worker exposure to asbestos during manufacturing of asbestos-containing products, but also includes requirements related to respiratory equipment, measurement of airborne fibers, and medical surveillance of exposed workers.

Ontario Regulation R.R.O 1990, Regulation 833, Control of Exposure to Biological or Chemical Agents, as amended (R.R.O. 1990, Reg. 833) made under the OHSA, sets the same time weighted average limit (TWA) value based on 8-hour work days.

Ontario Regulation 278/05 Designated Substance - Asbestos on Construction Projects and in Buildings and Repair Operations (O. Reg. 278/05), as amended, made under the OHSA defines an ACM as a material that contains 0.5% per cent or more asbestos by dry weight. Ontario Regulation 278/05 requires that an Asbestos Management Program (AMP) be implemented in buildings that have been identified to contain asbestos.

The general waste management regulation for the province of Ontario *R.R.O. 1990, Regulation 347 General - Waste Management*, as amended (R.R.O. 1990, Reg. 347) sets out the requirements for the proper disposal of asbestos waste in Ontario. The waste must be placed in a double sealed container, properly labelled, free of cuts, tears or punctures and disposed of at a licensed waste station which has



been properly notified of the shipment(s) of asbestos waste. Asbestos waste must be hauled in a vehicle operating under a Certificate of Approval (CofA) from the Ontario Ministry of the Environment and Climate Change (MOECC). The vehicle must have a trained operator as well as an asbestos spill kit. The asbestos waste must be immediately buried at the licensed landfill operation operating under a CofA from the MOECC.

The transport of asbestos waste to the disposal site is covered by the federal *Transportation of Dangerous Goods Act*. Asbestos waste is to be transported in a proper vehicle with appropriate placards and transportation numbering.

Lead

Lead may be used in its pure metallic form or combined chemically with other elements to form lead compounds. Metallic lead is used to make products such as electric storage batteries, ammunition, lead solder, radiation shields, pipes, and sheaths for electric cables. Metallic lead is sometimes combined with other metals such as copper, tin and antimony as lead alloys for use in the manufacture of a variety of metal products.

Organic lead compounds contain a lead atom covalently bonded to carbon. Common examples of organic lead compounds include lead "soaps" such as lead oleates, high pressure lubricants, and anti-knock agents in gasoline.

Inorganic lead compounds (or lead salts) result when lead is combined with an element other than carbon. Examples are lead oxide, lead chromate, lead carbonate and lead nitrate. Inorganic lead compounds may occur as solids or in solutions, and are used in insecticides, pigments, paints, frits, glasses, plastics, and rubber compounds.

Lead may affect the health of workers if it is in a form that may be inhaled, ingested or absorbed through the skin. Lead dust consists of small, solid particles of metallic lead or lead compounds that are generated by sanding, grinding, polishing, and sawing operations. Lead fume is produced in significant amounts when solid lead or materials containing lead are heated to temperatures above 500° C, as in welding and flame cutting or burning.

The United States Department of Housing and Urban Development (HUD) set a criteria of lead-based paint as 0.5% lead (by weight) or 5,000 parts per million (ppm) for evaluating whether lead is a hazard in a residential setting.

In Canada, the Surface Coating Materials Regulations (SOR/2005-109) under the Federal Hazardous Products Act provides a concentration of lead that must not be exceeded in surface coatings that are presently sold in this country. This value has recently been reduced from 600 ppm to 90 ppm. However, it is important to note that there is not a direct correlation between the concentration of lead in a material to the potential occupational exposure if the material is disturbed.

O. Reg. 490/09 (which does not apply to construction projects) and R.R.O. 1990 Reg. 833, an occupational exposure limit (OEL) for airborne lead dust or fumes has been set at the TWA value of 0.05 milligram per cubic metre of air (mg/m³) for workers. The TWA represents the time-weighted average



concentration for a conventional 8-hour workday and a 40-hour workweek, to which it is believed that nearly all workers may be repeatedly exposed, day after day, without adverse health effects.

The EACO document entitled *Lead Guideline for Construction, Renovation Maintenance or Repair*, issued October 2014 sets out guidelines for operations involving the handling, application, removal, disturbance or clean-up of lead-containing materials. The guideline is intended for the environmental abatement industry, construction industry and painting industry in general and is based on industry standard best-practices for lead abatement and dust control measures.

The Ontario Ministry of Labour (MOL) document entitled *Guideline: Lead on Construction Projects*, issued by the MOL in April 2011, states that the removal of lead paint is not required unless work on these materials are likely to produce airborne lead dust or fumes, for example during welding, torch cutting, sanding and sand blasting. If these operations are likely to occur during building renovations or demolition, it is recommended that the removal of lead paint be carried out in accordance with procedures outlined in the proposed regulation.

Although the TWA and some other requirements under O. Reg. 490/09 and R.R.O. 1990 Reg. 833 do not apply to construction projects, procedures that provide the equivalent level of protection should be implemented on such projects where exposure to lead is possible.

Mercury

Mercury is commonly found in buildings, as it is contained in mercury vapour lighting, thermostats, thermometers, and electrical mercury switches. If mercury is exposed to the air, odourless vapours are formed. The regulated occupational exposure limit for airborne mercury is 0.025 mg/ m³ (8-hour TWA) as prescribed in (O. Reg. 490/09) and R.R.O. 1990 Reg. 833.

In Canada, the Surface Coating Materials Regulations (SOR/2005-109) under the Federal Hazardous Products Act provides a concentration of mercury that must not be exceeded in surface coatings that are presently sold in this country. This value was set at 10 ppm in 2005. However, it is important to note that there is not a direct correlation between the concentration of mercury in a material to the potential occupational exposure if the material is disturbed.

Mercury is hazardous if it is inhaled or absorbed through the skin, therefore exposure controls (including both respiratory protection and skin protection) are important to consider.

Mercury disposal should be through a scrap dealer (elemental mercury), recycling firm for mercury vapour and returned to the manufacturer for light tubes and fixtures.

Mercury is included in O. Reg. 490/09 and applies to every employer and worker at a workplace where mercury is present, produced, processed, used, handled, or stored and at which the worker is likely to inhale, ingest, or absorb mercury (the maximum TWA for airborne mercury is 0.025 mg/ m³). Requirements related to exposure to mercury are detailed, including those relating to worker safety and the use of personal protective equipment.



Ontario's Waste Management (R.R.O. 1990, Reg. 347) under the *Environmental Protection Act* (EPA) provides directives for the disposal of hazardous materials such as mercury.

Silica

Silica, also referred to as free crystalline silica, is found in concrete, cement, mortar, ceramic wall and floor tiles, stucco finishes and acoustic ceiling tiles. Prolonged exposure to, and inhalation of free crystalline silica, may result in respiratory disease known as silicosis, which is characterized by progressive fibrosis of the inner lung tissue and marked shortness of breath or impaired lung function. The maximum TWA for airborne Silica dust is 0.05 mg/ m³ (O. Reg. 490/09 and R.R.O. 1990, Reg. 833).

Silica is included in O. Reg. 490/09 and the regulation provides information on the application of the regulation as well as allowable exposure levels, where the maximum TWA for airborne Silica dust is 0.05 mg/ m³. The assessment and control program and medical surveillance requirements are for non-construction projects as defined in O. Reg. 490/09. Refer to the document entitled *Guideline: Silica on Construction Projects*, issued by the MOL in April 2011 for safe silica work practices and personal protective equipment (PPE).

Acrylonitrile

Acrylonitrile is a clear liquid that may be colourless or yellow and that readily reacts with other chemicals to produce long, chain-like molecules (polymers). Acrylonitrile-based polymers are used to produce nitrile rubbers, plastics, acrylic fibers, coatings and adhesives. Workers are typically exposed to acrylonitrile at manufacturing facilities that produce the aforementioned products through inhaling its vapour, direct skin contact, or through ingestion. Although acrylonitrile may be present in some of the building materials, including adhesives and coatings, the chemical will likely be bonded in the polymer form. Therefore, it is not expected that an adverse exposure to acrylonitrile will occur unless the building materials are heated to extreme temperatures. Acrylonitrile vapours may become released from the acrylonitrile-based polymers during a process where high temperatures are applied.

The TWA for a worker with respect to Acrylonitrile is 2 ppm as prescribed in O. Reg. 490/09 and R.R.O. 1990 Reg. 833. The Short term Exposure Limit (STEL) for Acrylonitrile is 10 ppm for any 15-minute exposure period.

Arsenic

The presence of arsenic in the paint coating on interior and exterior finishes is possible. As the painted surfaces will be handled as per the proposed lead regulation, it is not expected that arsenic concentrations in the air will exceed the TWA for a worker to arsenic (10 µg/m³) as prescribed by O. Reg. 490/09 and R.R.O. 1990, Reg. 833. The STEL for arsenic is 50 µg/m³ for any 15-minute exposure period.

Benzene

Historically, benzene has been produced as a by-product of coal gasification and metallurgical coke production in steel making. The light oil product from such processes contains benzene, toluene, ethyl



benzene and xylene, and these components are separated by distillation. Today, most benzene is produced from the refining of petroleum.

Benzene has applications as a solvent in synthetic rubber manufacturing and processing, and in paints, varnishes, stains, adhesives, roofing materials and sealants. The use of benzene in tire and other rubber goods manufacturing and as a solvent and component of paints and adhesives has declined considerably as a result of concerns about workplace exposure. Nevertheless, it is often present in trace quantities in petroleum and aromatic solvents, some of which have replaced benzene in many uses. Benzene is also a minor component of gasoline mixtures sold in Canada.

The TWA for a worker to benzene is 0.5 ppm as prescribed by O. Reg. 490/09 and R.R.O. 1990, Reg. 833. It is possible that benzene was present in the paints, adhesives and roofing materials used during the original construction of many buildings. However, over time, the benzene component typically volatilizes out of the paints, solvents and roofing bitumens and is released into the ambient air. Therefore, it is likely that only trace levels of benzene presently exist in these building materials. It is not expected that benzene emissions from any existing building materials on site will exceed the allowable TWA. The STEL for benzene is 2.5 ppm for any 15-minute exposure period.

Coke Oven Emissions

Coke oven emissions are found in the exhaust from the burning process of coke and are typically not a concern in buildings. The TWA for a worker with respect to coke oven emissions is 150 µg/m³ as prescribed by O. Reg. 490/09 and R.R.O. 1990, Reg. 833.

Ethylene Oxides

Ethylene oxide is a common by product of fumigation or sterilization procedures.

The TWA for a worker with respect to ethylene oxides is 1 ppm as prescribed in O. Reg. 490/09 and R.R.O. 1990, Reg. 833. The STEL for ethylene oxides is 10 ppm for any 15-minute exposure period.

Isocyanates

Isocyanates are a class of chemicals used in the manufacture of certain types of plastics, foams and roof insulation. The isocyanate (-CNO) group reacts very readily with certain other types of molecules, a property responsible for the usefulness of isocyanates in industry. Due to the high reactivity of the isocyanate group, exposure to isocyanates can result in primary irritation, sensitization and hypersensitivity reactions. The respiratory system, the eyes and the skin are the main areas affected by exposure. Isocyanates in their initial form are found as a vapour, a mist, or a dust which become airborne and then taken into the body. Once the isocyanates are chemically bonded to other chemicals during manufacturing processes, the isocyanates are not readily available to become airborne unless heated. Therefore, isocyanate exposure is not expected to be a concern as long as the burning of plastics, foams, and insulation is not carried out.



The TWA for a worker with respect to isocyanates, organic compounds is 5 parts per billion (ppb) as prescribed in O. Reg. 490/09 and R.R.O. 1990, Reg. 833. The STEL for isocyanates, organic compounds is 20 ppb for any 15-minute exposure period.

Vinyl Chloride

Vinyl chloride is found in many applications in building such as plumbing pipes, protective coatings on insulated pipes and interior finishes (i.e., vinyl baseboard trim). Vinyl chlorides in the above materials are bound in a solid matrix and are unlikely to become airborne such that it would exceed the maximum allowable TWA of 1 ppm, as prescribed in O. Reg. 490/09 and R.R.O. 1990, Reg. 833.

HAZARDOUS BUILDING MATERIALS

Polychlorinated Biphenyls (PCBs)

The use of PCBs in electrical equipment such as transformers and capacitors, including capacitors found in fluorescent lamp ballasts, was common up to 1980. R.R.O 1990 Regulation 362 Waste Management – PCB's (R.R.O. 1990, Reg. 362) under the EPA, prohibits the use of PCBs in electrical equipment installed after July 1, 1980.

The TWA for a worker with respect to PCBs is 0.05 mg/ m³as prescribed in R.R.O. 1990, Reg. 833.

As of September 5, 2008, under Subsection 93(1) of the *Canadian Environmental Protection Act*, (CEPA), Federal PCB regulations have been published by the Canada Gazette Part II (SOR/2008-273) that impose specific deadlines for the elimination of all PCBs in concentrations at or above 50 milligrams/kilogram (mg/kg). The regulation requires the elimination of all PCBs and PCB-containing materials currently in-use and in storage and limits the period of time PCB materials can be stored before being eliminated. Other aspects of the regulation govern the labelling and reporting of stored PCB materials and equipment as well as improved practices for the management of PCBs that remain in use (i.e., those with PCB concentrations less than 50 mg/kg) until their eventual elimination.

Ozone-Depleting Substances

The regulations also imposes restrictions on the servicing and dismantling, disposing of or decommissioning of any system containing halocarbons and requires the recovery of halocarbons into an appropriate container by a certified individual. The regulation also details an owner's record-keeping obligations.

Ontario Regulation 463/10, *Ozone Depleting Substances and Other Halocarbons* (O. Reg. 463/10), under the EPA. The regulation imposes restrictions on the purchasing of refrigerants and on the servicing, dismantling, disposing of or decommissioning of equipment containing refrigerants or halon fire extinguishing agents.



Mould

Mould can be found everywhere in the outside environment, on plants, in soil and on dead and decaying matter (i.e., dead leaves). Mould requires two main conditions in order to grow - a source of food (a substrate typically comprised of cellulose) and water. Sources of food for mould are plentiful in outdoor and indoor environments; however, it is the presence of water in an indoor environment that will determine mould growth. The source of water can be a result of a water pipe leak or even excess condensation. Thus, the key to controlling mould indoors is to control the presence of water.

At present, there are no specific laws or regulations governing acceptable levels of mould in buildings. The lack of specific regulatory standards is due in part to an inability to establish exposure-response relationships. Variation in individual susceptibility, limitations in sampling and analytical techniques, and the vast number of fungal agents and their products make it difficult to establish safe levels of exposure for all individuals. With a lack of defined exposure criteria, current Health Canada and other agency guidelines on the assessment and control of mould contamination in public buildings are largely based on prudent avoidance (i.e., remove any indoor growth or amplification site of mould, regardless of the concentration of moulds or their products in the indoor environment).

Although there are currently no regulations in Canada pertaining specifically to mould in buildings, based on an Ontario MOL alert, employers are required by Section 25(2)(h) of the Occupational Health and Safety Act to take every precaution reasonable in the circumstances for the protection of workers.

The OHSA places a responsibility on constructors (Section 23), employers (Section 25), and supervisors (Section 27) to ensure the health and safety of workers. This includes protecting workers from mould in workplace buildings. Various sections of the Industrial, Construction, Mining or Health Care regulations may also apply to maintenance and remediation activities.

The Ontario MOL has published an Alert (MOL, 2000) indicating that sustained and/or extensive growth of visible mould on interior surfaces of a building is unacceptable and stating that mould growth on the interior surfaces of buildings is a risk factor for health problems.

Several guidelines and other resources describe procedures for the investigation and remediation of mould. The following documents indicate that mould observed in occupied building should be remediated in accordance with these procedures:

- *Environmental Abatement Council of Ontario's (EACO) Mould Abatement Guidelines, 2015 – Edition 3;*
- *Mould Guidelines for The Canadian Construction Industry, Canadian Construction Association – 82, 2004;*
- *Guidelines on Assessment and Remediation of Fungi in Indoor Environment, New York City Department of Health and Mental Hygiene, November 2008*
- *Bioaerosols: Assessment and Control, American Conference of Governmental Industrial Hygienists (ACGIH), 1999*
- *Fungal Contamination in Public Buildings: Health Effects and Investigation Methods, Federal-Provincial Committee on Environmental and Occupational Health, 2004*



- *Field Guide for the Determination of Biological Contaminants in Environmental Samples*, American Industrial Hygiene Association (AIHA), 1996
- *Clean-Up Procedures for Mould in Houses*, Canada Mortgage and Housing Corporation (CMHC), 2004
- *Standard and Reference Guide for Professional Water Damage Restoration – IICRC S500*, Institute of Inspection, Cleaning and Restoration Certification, 2015
- *Reference Guide for Professional Mould Remediation – IICRC S520*, Institute of Inspection, Cleaning and Restoration Certification, 2015

Urea Formaldehyde Foam Insulation

Urea-formaldehyde foam insulation (UFFI) was developed in Europe in the 1950s as an improved means of insulating difficult-to-reach cavities in building walls. It is typically made at a construction site from a mixture of urea-formaldehyde resin, a foaming agent and compressed air. When the mixture is injected into the wall, urea and formaldehyde unite and "cure" into an insulating foam plastic.

During the 1970s, when concerns about energy efficiency led to efforts to improve home insulation in Canada, UFFI became an important insulation product for existing houses. Most installations occurred between 1977 and its ban in Canada in 1980.

In the insulating process, a slight excess of formaldehyde was often added to ensure complete "curing" with the urea to produce the urea-formaldehyde foam. Formaldehyde is a pungent, colourless gas commonly used in water solution as a preservative and disinfectant. It is also a basis for major plastics, including durable adhesives. It occurs naturally in the human body and in the outdoor environment. Formaldehyde is used to bond plywood, particleboard, carpets and fabrics. Formaldehyde is also a by-product of combustion; it is found in tobacco smoke, vehicle exhaust and the fumes from furnaces, fireplaces and wood stoves.

While small amounts of formaldehyde are harmless, it is an irritating and toxic gas in significant concentrations. Symptoms of overexposure to formaldehyde include irritation to eyes, nose and throat; persistent cough and respiratory distress; skin irritation; nausea; headache; and dizziness.

Health Canada has determined that 0.1 parts per million (ppm) is a safe level of formaldehyde in the home. Sensitivity to this level may vary based on individual age and health.

Tests show that UFFI is not a source of over-exposure to formaldehyde after the initial curing and release of excess gas. As it was last installed in 1980, it would certainly not be causing excess indoor formaldehyde today. Buildings with UFFI show no higher formaldehyde levels than those without it. However, if UFFI comes in contact with water or moisture, it could begin to break down. Wet or deteriorating UFFI should be removed by a specialist and the source of the moisture problem should be repaired.

There are currently no regulations in Canada pertaining specifically to UFFI in buildings. However, the Occupational Health and Safety Act places a responsibility on constructors (Section 23), employers (Section 25), and supervisors (Section 27) to ensure the health and safety of workers.



Appendix B SITE PHOTOGRAPHS



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON



Photo 1: Exterior view of the house.



Photo 2: Damaged asbestos-containing paper-backing associated with vinyl sheet flooring – white found beneath laminate flooring in first floor kitchen.



Photo 3: Damaged asbestos-containing drywall joint-fill compound in first floor laundry room.



Photo 4: Asbestos-containing 9"x9" vinyl floor tile – white with green flecks in first floor foyer closet.





Photo 5: Asbestos-containing 12"x12" vinyl floor tile – beige pattern found beneath laminate flooring in first floor laundry room.



Photo 6: Asbestos-containing 12"x12" vinyl floor tile – beige found beneath laminate flooring in first floor living room.



Photo 7: Asbestos-containing 12"x12" vinyl floor tile – red found beneath laminate flooring in first floor kitchen.



Photo 8: Asbestos-containing exterior window caulking – white (crawlspace windows only).



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON



Photo 9: Asbestos-containing exterior window caulking – white (between frame and wall).



Photo 10: Asbestos-containing exterior window glazing compound – grey.



Photo 11: Presumed asbestos-containing roofing materials and roof caulking.



Photo 12: Presumed asbestos-containing mastic associated with 12"x12" vinyl floor tile – beige pattern beneath laminate flooring in first floor laundry room.



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON



Photo 13: Damaged lead-containing brown coloured paint on exterior window frames.



Photo 14: Lead-containing grey coloured paint on first floor living room drywall walls.



Photo 15: Lead-containing white coloured paint on second floor hallway drywall walls.

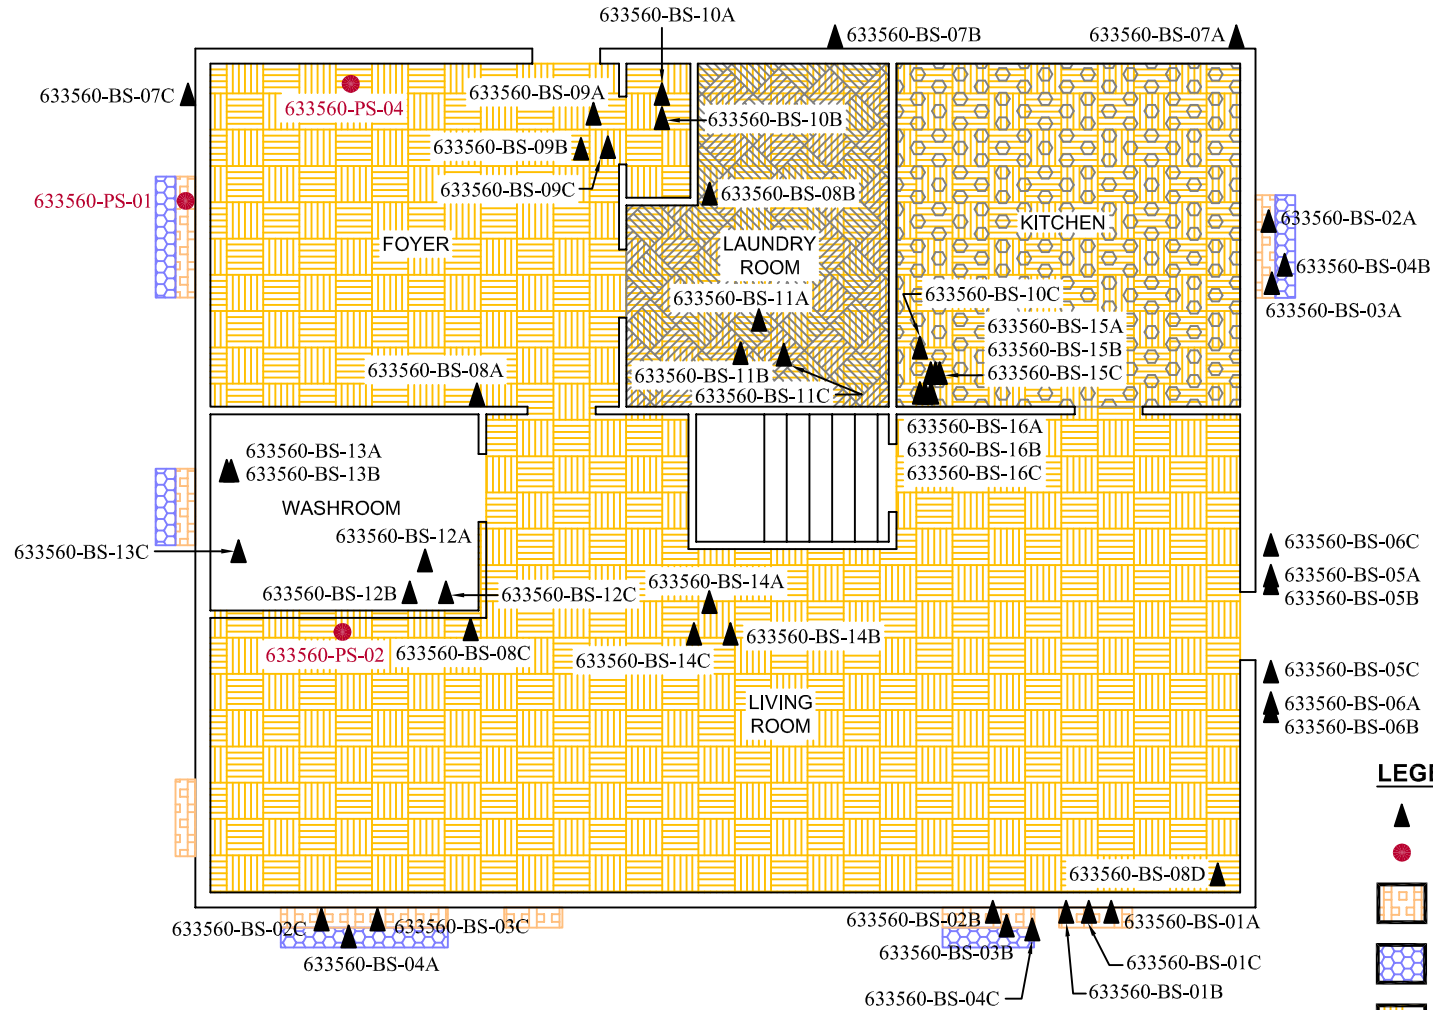


Photo 16: Suspect mould observed on wood framing beneath wood panel wall in second floor bedroom 3.



Appendix C FLOOR PLANS






FIRST FLOOR

LEGEND

- ▲ BULK SAMPLE
- PAINT CHIP SAMPLE
- ASBESTOS-CONTAINING CAULKING
- ASBESTOS-CONTAINING WINDOW GLAZING COMPOUND
- ASBESTOS-CONTAINING VINYL FLOOR TILES
- ASBESTOS-CONTAINING VINYL SHEET FLOORING
- PRESUMED ASBESTOS-CONTAINING MASTIC

NOTES: 1. DRYWALL JOINT-FILL COMPOUND IS IDENTIFIED BY LABORATORY ANALYSIS TO BE ASBESTOS-CONTAINING.
 2. THIS DRAWING ILLUSTRATES SUPPORTING INFORMATION SPECIFIC TO A STANTEC CONSULTING LTD. REPORT AND MUST NOT BE USED FOR OTHER PURPOSES.

<h2 style="margin: 0;">FLOOR PLAN</h2> <p style="margin: 0;">PIN 633560, 1968 WOODVIEW AVENUE, PICKERING, ONTARIO</p>	Project No.: 122151011	<p style="font-size: 24pt; margin: 0;">1</p>
	Scale: N.T.S.	
Date: 19/11/27		
Dwn. By: CD <small>SL2019110199</small> VM/DM		
App'd By: LF		
Client: PUBLIC SERVICES AND PROCUREMENT CANADA		

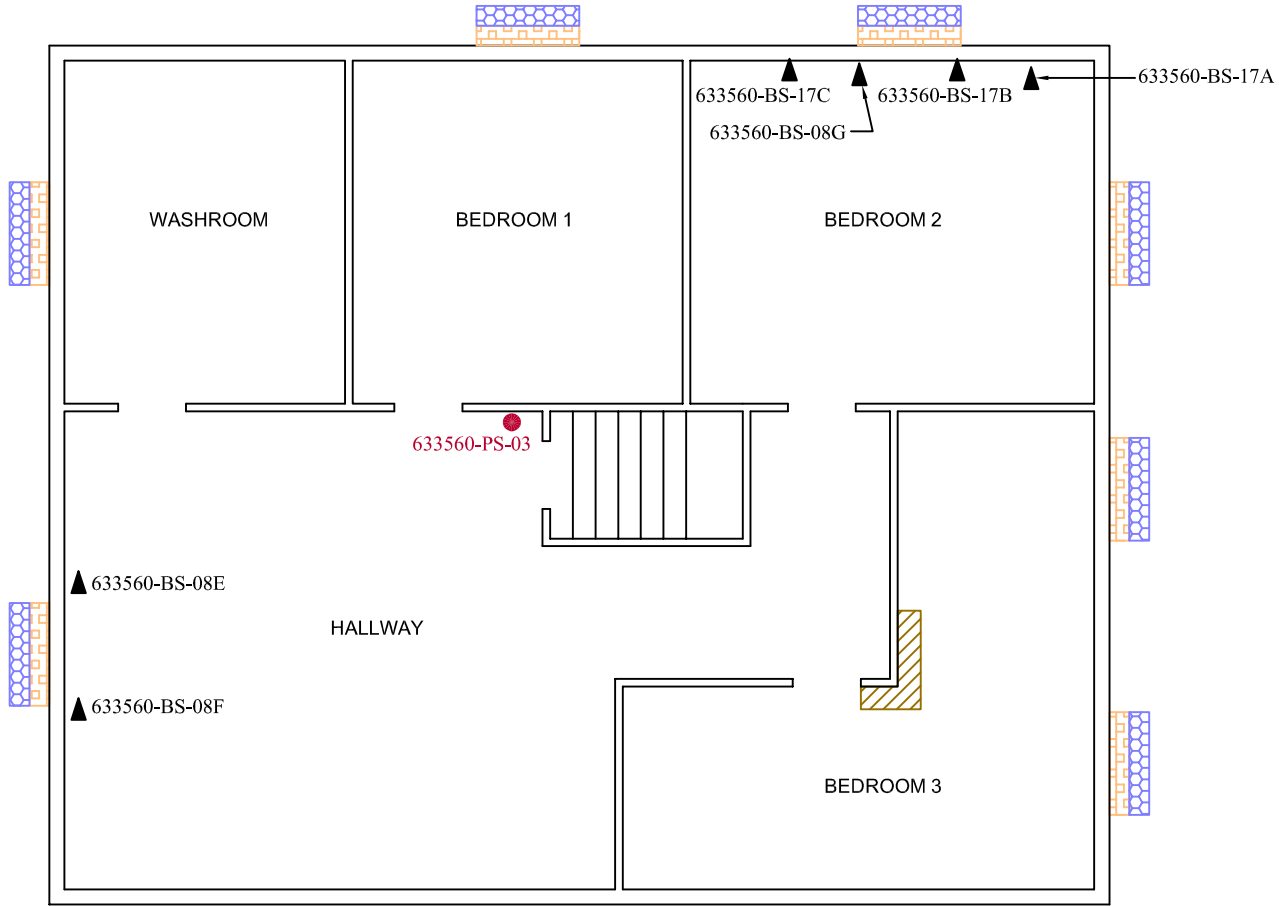

SECOND FLOOR

LEGEND

- BULK SAMPLE
- PAINT CHIP SAMPLE
- ASBESTOS-CONTAINING CAULKING
- ASBESTOS-CONTAINING WINDOW GLAZING COMPOUND
- SUSPECT MOULD

- NOTES:**
1. DRYWALL JOINT-FILL COMPOUND IS IDENTIFIED BY LABORATORY ANALYSIS TO BE ASBESTOS-CONTAINING.
 2. ROOFING MATERIALS AND ROOF CAULKING ARE PRESUMED TO BE ASBESTOS-CONTAINING.
 3. THIS DRAWING ILLUSTRATES SUPPORTING INFORMATION SPECIFIC TO A STANTEC CONSULTING LTD. REPORT AND MUST NOT BE USED FOR OTHER PURPOSES.

<h2 style="margin: 0;">FLOOR PLAN</h2> <p style="margin: 0;">PIN 633560, 1968 WOODVIEW AVENUE, PICKERING, ONTARIO</p>	Project No.: 122151011	2	
	Scale: N.T.S.		
	Date: 19/11/27		
	Dwn. By: CD <small>SL2019110200</small> VM/DM		
Client: PUBLIC SERVICES AND PROCUREMENT CANADA	App'd By: LF		

Appendix D SUMMARY OF RESULTS OF ANALYSIS OF BULK SAMPLES FOR ASBESTOS



Summary of Bulk Sample Analysis for Asbestos Type and Content

Sample Number	Sampling Location	Description of Sampled Material	Asbestos Type and Content
633560-BS-01A	Exterior - basement window	Exterior window caulking - white	3.0% chrysotile
633560-BS-01B	Exterior - basement window	Exterior window caulking - white	Positive Stop (Not Analyzed)
633560-BS-01C	Exterior - basement window	Exterior window caulking - white	Positive Stop (Not Analyzed)
633560-BS-02A	Exterior - window	Exterior window caulking - white (glass and frame)	None Detected
633560-BS-02B	Exterior - window	Exterior window caulking - white (glass and frame)	None Detected
633560-BS-02C	Exterior - window	Exterior window caulking - white (glass and frame)	None Detected
633560-BS-03A	Exterior - window	Exterior window caulking - white (frame and wall)	1.1% chrysotile
633560-BS-03B	Exterior - window	Exterior window caulking - white (frame and wall)	Positive Stop (Not Analyzed)
633560-BS-03C	Exterior - window	Exterior window caulking - white (frame and wall)	Positive Stop (Not Analyzed)
633560-BS-04A	Exterior - window	Exterior window glazing compound - grey	2.1% chrysotile
633560-BS-04B	Exterior - window	Exterior window glazing compound - grey	Positive Stop (Not Analyzed)
633560-BS-04C	Exterior - window	Exterior window glazing compound - grey	Positive Stop (Not Analyzed)
633560-BS-05A	Exterior - door	Exterior door caulking - brown (1st Layer)	None Detected
633560-BS-05B	Exterior - door	Exterior door caulking - brown (1st Layer)	None Detected
633560-BS-05C	Exterior - door	Exterior door caulking - brown (1st Layer)	None Detected
633560-BS-06A	Exterior - door	Exterior door caulking - brown (2nd Layer)	None Detected
633560-BS-06B	Exterior - door	Exterior door caulking - brown (2nd Layer)	None Detected

Summary of Bulk Sample Analysis for Asbestos Type and Content

Sample Number	Sampling Location	Description of Sampled Material	Asbestos Type and Content
633560-BS-06C	Exterior - door	Exterior door caulking - brown (2nd Layer)	None Detected
633560-BS-07A	Exterior - wall	Exterior brick mortar	None Detected
633560-BS-07B	Exterior - wall	Exterior brick mortar	None Detected
633560-BS-07C	Exterior - wall	Exterior brick mortar	None Detected
633560-BS-08A-BEIGE	First floor - foyer, wall	Drywall joint-fill compound	2% chrysotile
633560-BS-08A-WHITE	First floor - foyer, wall	Drywall joint-fill compound	None Detected
633560-BS-08B	First floor - laundry room, wall	Drywall joint-fill compound	Positive Stop (Not Analyzed)
633560-BS-08C	First floor - living room, wall	Drywall joint-fill compound	Positive Stop (Not Analyzed)
633560-BS-08D	First floor - living room, wall	Drywall joint-fill compound	Positive Stop (Not Analyzed)
633560-BS-08E	Second floor - hallway, wall	Drywall joint-fill compound	Positive Stop (Not Analyzed)
633560-BS-08F	Second floor - hallway, wall	Drywall joint-fill compound	Positive Stop (Not Analyzed)
633560-BS-08G	Second floor - bedroom 2, wall	Drywall joint-fill compound	Positive Stop (Not Analyzed)
633560-BS-09A-GROUT	First floor - foyer, floor	12"x12" ceramic tile grout - beige	None Detected
633560-BS-09A-MORTAR	First floor - foyer, floor	12"x12" ceramic tile mortar - beige	None Detected
633560-BS-09B-GROUT	First floor - foyer, floor	12"x12" ceramic tile grout - beige	None Detected
633560-BS-09B-MORTAR	First floor - foyer, floor	12"x12" ceramic tile mortar - beige	None Detected
633560-BS-09C-GROUT	First floor - foyer, floor	12"x12" ceramic tile grout - beige	None Detected
633560-BS-09C-MORTAR	First floor - foyer, floor	12"x12" ceramic tile mortar - beige	None Detected

Summary of Bulk Sample Analysis for Asbestos Type and Content

Sample Number	Sampling Location	Description of Sampled Material	Asbestos Type and Content
633560-BS-10A-FLOOR TILE	First floor - foyer, closet	9"x9" vinyl floor tile - white with green flecks	0.70% chrysotile
633560-BS-10A-MASTIC	First floor - foyer, closet	Mastic associated with 9"x9" vinyl floor tile - white with green flecks	None Detected
633560-BS-10B-FLOOR TILE	First floor - foyer, closet	9"x9" vinyl floor tile - white with green flecks	Positive Stop (Not Analyzed)
633560-BS-10B-MASTIC	First floor - foyer, closet	Mastic associated with 9"x9" vinyl floor tile - white with green flecks	None Detected
633560-BS-10C-FLOOR TILE	First floor - kitchen	9"x9" vinyl floor tile - white with green flecks	Positive Stop (Not Analyzed)
633560-BS-10C-MASTIC	First floor - kitchen	Mastic associated with 9"x9" vinyl floor tile - white with green flecks	None Detected
633560-BS-11A	First floor - laundry room	12"x12" vinyl floor tile - beige pattern found beneath laminte floor	2.2% chrysotile
633560-BS-11B	First floor - laundry room	12"x12" vinyl floor tile - beige pattern found beneath laminte floor	Positive Stop (Not Analyzed)
633560-BS-11C	First floor - laundry room	12"x12" vinyl floor tile - beige pattern found beneath laminte floor	Positive Stop (Not Analyzed)
633560-BS-12A-GROUT	First floor - washroom, floor	12"x12" ceramic tile grout - white	None Detected
633560-BS-12A-MORTAR	First floor - washroom, floor	12"x12" ceramic tile mortar - white	None Detected
633560-BS-12B-GROUT	First floor - washroom, floor	12"x12" ceramic tile grout - white	None Detected
633560-BS-12B-MORTAR	First floor - washroom, floor	12"x12" ceramic tile mortar - white	None Detected
633560-BS-12C-GROUT	First floor - washroom, floor	12"x12" ceramic tile grout - white	None Detected
633560-BS-12C-MORTAR	First floor - washroom, floor	12"x12" ceramic tile mortar - white	None Detected
633560-BS-13A-ADHESIVE	First floor - washroom, wall	ceramic tile - mortar	None Detected
633560-BS-13A-GROUT	First floor - washroom, wall	ceramic tile - mortar	None Detected

Summary of Bulk Sample Analysis for Asbestos Type and Content

Sample Number	Sampling Location	Description of Sampled Material	Asbestos Type and Content
633560-BS-13A-LEVELER	First floor - washroom, wall	ceramic tile - mortar	None Detected
633560-BS-13B	First floor - washroom, wall	ceramic tile - mortar	None Detected
633560-BS-13C-ADHESIVE/LEVELER	First floor - washroom, wall	ceramic tile - mortar	None Detected
633560-BS-13C-GROUT	First floor - washroom, wall	ceramic tile - mortar	None Detected
633560-BS-14A-FLOOR TILE	First floor - living room	12"x12" vinyl floor tile - beige found beneath laminate floor	3.9% chrysotile
633560-BS-14A-MASTIC	First floor - living room	Mastic associated with 12"x12" vinyl floor tile - beige found beneath laminate floor	None Detected
633560-BS-14B-FLOOR TILE	First floor - living room	12"x12" vinyl floor tile - beige found beneath laminate floor	Positive Stop (Not Analyzed)
633560-BS-14B-MASTIC	First floor - living room	Mastic associated with 12"x12" vinyl floor tile - beige found beneath laminate floor	None Detected
633560-BS-14C-FLOOR TILE	First floor - living room	12"x12" vinyl floor tile - beige found beneath laminate floor	Positive Stop (Not Analyzed)
633560-BS-14C-MASTIC	First floor - living room	Mastic associated with 12"x12" vinyl floor tile - beige found beneath laminate floor	None Detected
633560-BS-15A	First floor - kitchen	Paper-backing associated with vinyl sheet flooring - white (1st Layer)	35% chrysotile
633560-BS-15B	First floor - kitchen	Paper-backing associated with vinyl sheet flooring - white (1st Layer)	Positive Stop (Not Analyzed)
633560-BS-15C	First floor - kitchen	Paper-backing associated with vinyl sheet flooring - white (1st Layer)	Positive Stop (Not Analyzed)
633560-BS-16A	First floor - kitchen	12"x12" vinyl floor tile - red (2nd layer)	1.0% chrysotile
633560-BS-16B	First floor - kitchen	12"x12" vinyl floor tile - red (2nd layer)	Positive Stop (Not Analyzed)
633560-BS-16C	First floor - kitchen	12"x12" vinyl floor tile - red (2nd layer)	Positive Stop (Not Analyzed)

Summary of Bulk Sample Analysis for Asbestos Type and Content

Sample Number	Sampling Location	Description of Sampled Material	Asbestos Type and Content
633560-BS-17A- JOINT COMPOUND	Second floor - bedroom 2, north wall	Texture coat	<0.25% chrysotile
633560-BS-17A- TEXTURE	Second floor - bedroom 2, north wall	Texture coat	None Detected
633560-BS-17B	Second floor - bedroom 2, north wall	Texture coat	None Detected
633560-BS-17C	Second floor - bedroom 2, north wall	Texture coat	None Detected

Appendix E LABORATORY ANALYTICAL REPORT – ASBESTOS: POLARIZED LIGHT MICROSCOPY





EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
 Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
 Customer ID: 55JACQ30J
 Customer PO: 122151011.200
 Project ID:

Attn: Will Madden-Macavellia
 Stantec Consulting Ltd.
 300-675 Cochrane Drive, West Tower
 Markham, ON L3R 0B8

Phone: (905) 474-7700
Fax: (905) 479-9326
Collected: 11/ 7/2019
Received: 11/11/2019
Analyzed: 11/15/2019

Proj: PIN# 633560

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-01A **Lab Sample ID:** 551913658-0001

Sample Description: Exterior - basement window/Exterior window caulking - white

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	White	0.0%	97.0%	3.0% Chrysotile	

Client Sample ID: 633560-BS-01B **Lab Sample ID:** 551913658-0002

Sample Description: Exterior - basement window/Exterior window caulking - white

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-01C **Lab Sample ID:** 551913658-0003

Sample Description: Exterior - basement window/Exterior window caulking - white

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-02A **Lab Sample ID:** 551913658-0004

Sample Description: Exterior - window/Exterior window caulking - white (glass and frame)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	White	0.0%	100%	None Detected	

Client Sample ID: 633560-BS-02B **Lab Sample ID:** 551913658-0005

Sample Description: Exterior - window/Exterior window caulking - white (glass and frame)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	White	0.0%	100%	None Detected	

Client Sample ID: 633560-BS-02C **Lab Sample ID:** 551913658-0006

Sample Description: Exterior - window/Exterior window caulking - white (glass and frame)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	White	0.0%	100%	None Detected	

Client Sample ID: 633560-BS-03A **Lab Sample ID:** 551913658-0007

Sample Description: Exterior - window/Exterior window caulking - white (frame and wall)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	Gray	0.0%	98.9%	1.1% Chrysotile	



EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
Customer ID: 55JACQ30J
Customer PO: 122151011.200
Project ID:

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-03B **Lab Sample ID:** 551913658-0008

Sample Description: Exterior - window/Exterior window caulking - white (frame and wall)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-03C **Lab Sample ID:** 551913658-0009

Sample Description: Exterior - window/Exterior window caulking - white (frame and wall)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-04A **Lab Sample ID:** 551913658-0010

Sample Description: Exterior - window/Exterior window glazing compound - grey

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	Brown	0.0%	97.9%	2.1% Chrysotile	

Client Sample ID: 633560-BS-04B **Lab Sample ID:** 551913658-0011

Sample Description: Exterior - window/Exterior window glazing compound - grey

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-04C **Lab Sample ID:** 551913658-0012

Sample Description: Exterior - window/Exterior window glazing compound - grey

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-05A **Lab Sample ID:** 551913658-0013

Sample Description: Exterior - door/Exterior door caulking - brown (1st Layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	Brown	0.0%	100%	None Detected	

Client Sample ID: 633560-BS-05B **Lab Sample ID:** 551913658-0014

Sample Description: Exterior - door/Exterior door caulking - brown (1st Layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	Brown	0.0%	100%	None Detected	

Client Sample ID: 633560-BS-05C **Lab Sample ID:** 551913658-0015

Sample Description: Exterior - door/Exterior door caulking - brown (1st Layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	Brown	0.0%	100%	None Detected	



EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
Customer ID: 55JACQ30J
Customer PO: 122151011.200
Project ID:

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-06A **Lab Sample ID:** 551913658-0016

Sample Description: Exterior - door/Exterior door caulking - brown (2nd Layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	Gray	0.0%	100%	None Detected	

Client Sample ID: 633560-BS-06B **Lab Sample ID:** 551913658-0017

Sample Description: Exterior - door/Exterior door caulking - brown (2nd Layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	Gray	0.0%	100%	None Detected	

Client Sample ID: 633560-BS-06C **Lab Sample ID:** 551913658-0018

Sample Description: Exterior - door/Exterior door caulking - brown (2nd Layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	Gray	0.0%	100%	None Detected	

Client Sample ID: 633560-BS-07A **Lab Sample ID:** 551913658-0019

Sample Description: Exterior - wall/Exterior brick mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Brown	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-07B **Lab Sample ID:** 551913658-0020

Sample Description: Exterior - wall/Exterior brick mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Brown	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-07C **Lab Sample ID:** 551913658-0021

Sample Description: Exterior - wall/Exterior brick mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Brown	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-08A-White **Lab Sample ID:** 551913658-0022

Sample Description: First floor - foyer, wall/Drywall joint-fill compound

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	White	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-08A-Beige **Lab Sample ID:** 551913658-0022A

Sample Description: First floor - foyer, wall/Drywall joint-fill compound

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Beige	0.0%	98.0%	2% Chrysotile	



EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
Customer ID: 55JACQ30J
Customer PO: 122151011.200
Project ID:

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-08B **Lab Sample ID:** 551913658-0023

Sample Description: First floor - laundry room, wall/Drywall joint-fill compound

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019					Positive Stop (Not Analyzed)

Client Sample ID: 633560-BS-08C **Lab Sample ID:** 551913658-0024

Sample Description: First floor - living room, wall/Drywall joint-fill compound

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019					Positive Stop (Not Analyzed)

Client Sample ID: 633560-BS-08D **Lab Sample ID:** 551913658-0025

Sample Description: Second floor - hallway, wall/Drywall joint-fill compound

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019					Positive Stop (Not Analyzed)

Client Sample ID: 633560-BS-08E **Lab Sample ID:** 551913658-0026

Sample Description: Second floor - hallway, wall/Drywall joint-fill compound

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019					Positive Stop (Not Analyzed)

Client Sample ID: 633560-BS-08F **Lab Sample ID:** 551913658-0027

Sample Description: Second floor - bedroom 2, wall/Drywall joint-fill compound

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019					Positive Stop (Not Analyzed)

Client Sample ID: 633560-BS-08G **Lab Sample ID:** 551913658-0028

Sample Description: First floor - foyer, floor/Drywall joint-fill compound

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019					Positive Stop (Not Analyzed)

Client Sample ID: 633560-BS-09A-Grout **Lab Sample ID:** 551913658-0029

Sample Description: First floor - foyer, floor/12x12 ceramic tile grout - beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-09A-Mortar **Lab Sample ID:** 551913658-0030

Sample Description: First floor - foyer, floor/12x12 ceramic tile mortar - beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	



EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
Customer ID: 55JACQ30J
Customer PO: 122151011.200
Project ID:

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-09B-Grout **Lab Sample ID:** 551913658-0031

Sample Description: First floor - foyer, floor/12x12 ceramic tile grout - beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-09B-Mortar **Lab Sample ID:** 551913658-0032

Sample Description: First floor - foyer, floor/12x12 ceramic tile mortar - beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-09C-Grout **Lab Sample ID:** 551913658-0033

Sample Description: First floor - foyer, floor/12x12 ceramic tile grout - beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-09C-Mortar **Lab Sample ID:** 551913658-0034

Sample Description: First floor - foyer, floor/12x12 ceramic tile mortar - beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-10A-Floor Tile **Lab Sample ID:** 551913658-0035

Sample Description: First floor - foyer, closet/9x9 vinyl floor tile - white with green flecks

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019	Beige	0.0%	99.3%	0.70% Chrysotile	
TEM Grav. Reduction	11/15/2019		Positive Stop (Not Analyzed)			

Client Sample ID: 633560-BS-10A-Mastic **Lab Sample ID:** 551913658-0035A

Sample Description: First floor - foyer, closet/9x9 vinyl floor tile - white with green flecks

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	Black	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-10B-Floor Tile **Lab Sample ID:** 551913658-0036

Sample Description: First floor - foyer, closet/9x9 vinyl floor tile - white with green flecks

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019		Positive Stop (Not Analyzed)			
TEM Grav. Reduction	11/15/2019		Positive Stop (Not Analyzed)			

Client Sample ID: 633560-BS-10B-Mastic **Lab Sample ID:** 551913658-0036A

Sample Description: First floor - foyer, closet/9x9 vinyl floor tile - white with green flecks

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	Black	0.0%	100.0%	None Detected	



EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
 Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
 Customer ID: 55JACQ30J
 Customer PO: 122151011.200
 Project ID:

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-10C-Floor Tile **Lab Sample ID:** 551913658-0037

Sample Description: First floor - kitchen/9x9 vinyl floor tile - white with green flecks

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/14/2019				Positive Stop (Not Analyzed)	
TEM Grav. Reduction	11/15/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-10C-Mastic **Lab Sample ID:** 551913658-0037A

Sample Description: First floor - kitchen/9x9 vinyl floor tile - white with green flecks

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	Black	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-11A **Lab Sample ID:** 551913658-0038

Sample Description: First floor - laundry room/12x12 vinyl floor tile - beige pattern found beneath laminate floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	Beige	0.0%	99.6%	0.44% Chrysotile	
TEM Grav. Reduction	11/15/2019	Beige	0.0%	97.8%	2.2% Chrysotile	

Client Sample ID: 633560-BS-11B **Lab Sample ID:** 551913658-0039

Sample Description: First floor - laundry room/12x12 vinyl floor tile - beige pattern found beneath laminate floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	Beige	0.0%	99.7%	0.31% Chrysotile	
TEM Grav. Reduction	11/15/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-11C **Lab Sample ID:** 551913658-0040

Sample Description: First floor - laundry room/12x12 vinyl floor tile - beige pattern found beneath laminate floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	Beige	0.0%	100%	<0.25% Chrysotile	
TEM Grav. Reduction	11/15/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-12A-Grout **Lab Sample ID:** 551913658-0041

Sample Description: First floor - washroom, floor/12x12 ceramic tile grout - white

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-12A-Mortar **Lab Sample ID:** 551913658-0042

Sample Description: First floor - washroom, floor/12x12 ceramic tile mortar - white

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	



EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
Customer ID: 55JACQ30J
Customer PO: 122151011.200
Project ID:

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-12B-Grout **Lab Sample ID:** 551913658-0043

Sample Description: First floor - washroom, floor/12x12 ceramic tile grout - white

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-12B-Mortar **Lab Sample ID:** 551913658-0044

Sample Description: First floor - washroom, floor/12x12 ceramic tile mortar - white

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-12C-Grout **Lab Sample ID:** 551913658-0045

Sample Description: First floor - washroom, floor/12x12 ceramic tile grout - white

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-12C-Mortar **Lab Sample ID:** 551913658-0046

Sample Description: First floor - washroom, floor/12x12 ceramic tile mortar - white

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-13A-Adhesive **Lab Sample ID:** 551913658-0047

Sample Description: First floor - washroom, wall/Ceramic tile - mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	White	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-13A-Leveler **Lab Sample ID:** 551913658-0047A

Sample Description: First floor - washroom, wall/Ceramic tile - mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	White	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-13A-Grout **Lab Sample ID:** 551913658-0047B

Sample Description: First floor - washroom, wall/Ceramic tile - mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Brown	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-13B **Lab Sample ID:** 551913658-0048

Sample Description: First floor - washroom, wall/Ceramic tile - mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	White	0.0%	100.0%	None Detected	Layers inseparable



EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
 Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
 Customer ID: 55JACQ30J
 Customer PO: 122151011.200
 Project ID:

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-13C-Adhesive/Leveler **Lab Sample ID:** 551913658-0049
Sample Description: First floor - washroom, wall/Ceramic tile - mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	White	0.0%	100.0%	None Detected	Layers inseparable

Client Sample ID: 633560-BS-13C-Grout **Lab Sample ID:** 551913658-0049A
Sample Description: First floor - washroom, wall/Ceramic tile - mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/14/2019	Brown	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-14A-Floor Tile **Lab Sample ID:** 551913658-0050
Sample Description: First floor - living room/12x12 vinyl floor tile - beige found beneath laminate floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	White	0.0%	99.6%	0.39% Chrysotile	
TEM Grav. Reduction	11/15/2019	White	0.0%	96.1%	3.9% Chrysotile	

Client Sample ID: 633560-BS-14A-Mastic **Lab Sample ID:** 551913658-0050A
Sample Description: First floor - living room/12x12 vinyl floor tile - beige found beneath laminate floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	Black	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-14B-Floor Tile **Lab Sample ID:** 551913658-0051
Sample Description: First floor - living room/12x12 vinyl floor tile - beige found beneath laminate floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	White	0.0%	100%	<0.25% Chrysotile	
TEM Grav. Reduction	11/15/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-14B-Mastic **Lab Sample ID:** 551913658-0051A
Sample Description: First floor - living room/12x12 vinyl floor tile - beige found beneath laminate floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	Black	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-14C-Floor Tile **Lab Sample ID:** 551913658-0052
Sample Description: First floor - living room/12x12 vinyl floor tile - beige found beneath laminate floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	White	0.0%	99.7%	0.26% Chrysotile	
TEM Grav. Reduction	11/15/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-14C-Mastic **Lab Sample ID:** 551913658-0052A
Sample Description: First floor - living room/12x12 vinyl floor tile - beige found beneath laminate floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	Black	0.0%	100.0%	None Detected	



EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
Customer ID: 55JACQ30J
Customer PO: 122151011.200
Project ID:

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-15A **Lab Sample ID:** 551913658-0053

Sample Description: First floor - kitchen/Paper-backing associated with vinyl sheet flooring - white (1st layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	Beige	0.0%	65.0%	35% Chrysotile	

Client Sample ID: 633560-BS-15B **Lab Sample ID:** 551913658-0054

Sample Description: First floor - kitchen/Paper-backing associated with vinyl sheet flooring - white (1st layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-15C **Lab Sample ID:** 551913658-0055

Sample Description: First floor - kitchen/Paper-backing associated with vinyl sheet flooring - white (1st layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-16A **Lab Sample ID:** 551913658-0056

Sample Description: First floor - kitchen/12x12 vinyl floor tile - red (2nd layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	Red	0.0%	100%	<0.25% Chrysotile	
TEM Grav. Reduction	11/15/2019	Red	0.0%	99.0%	1.0% Chrysotile	

Client Sample ID: 633560-BS-16B **Lab Sample ID:** 551913658-0057

Sample Description: First floor - kitchen/12x12 vinyl floor tile - red (2nd layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	Red	0.0%	100%	<0.25% Chrysotile	
TEM Grav. Reduction	11/15/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-16C **Lab Sample ID:** 551913658-0058

Sample Description: First floor - kitchen/12x12 vinyl floor tile - red (2nd layer)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM Grav. Reduction	11/15/2019	Red	0.0%	99.7%	0.33% Chrysotile	
TEM Grav. Reduction	11/15/2019				Positive Stop (Not Analyzed)	

Client Sample ID: 633560-BS-17A-Texture **Lab Sample ID:** 551913658-0059

Sample Description: Second floor - bedroom 2, north wall/Texture Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	White	0.0%	100.0%	None Detected	



EMSL Canada Inc.

2756 Slough Street Mississauga, ON L4T 1G3
Phone/Fax: (289) 997-4602 / (289) 997-4607
<http://www.EMSL.com> / torontolab@emsl.com

EMSL Canada Order 551913658
Customer ID: 55JACQ30J
Customer PO: 122151011.200
Project ID:

Test Report: Asbestos Analysis of Bulk Materials for Ontario Regulation 278/05 via EPA600/R-93/116 Method

Client Sample ID: 633560-BS-17A-Joint Compound **Lab Sample ID:** 551913658-0059A

Sample Description: Second floor - bedroom 2, north wall/Texture Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	Beige	0.0%	100.0%	<1% Chrysotile	
400 PLM Pt Ct	11/15/2019	Beige	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: 633560-BS-17B **Lab Sample ID:** 551913658-0060

Sample Description: Second floor - bedroom 2, north wall/Texture Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	White	0.0%	100.0%	None Detected	

Client Sample ID: 633560-BS-17C **Lab Sample ID:** 551913658-0061

Sample Description: Second floor - bedroom 2, north wall/Texture Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	11/15/2019	White/Beige	0.0%	100.0%	None Detected	

Analyst(s):

- Caroline Allen PLM (5)
400 PLM Pt Ct (1)
- Ioana Taina PLM (23)
- Natalie D'Amico PLM (2)
PLM Grav. Reduction (6)
TEM Grav. Reduction (3)
- Tiffany Pilon PLM (4)
PLM Grav. Reduction (16)

Reviewed and approved by:

Matthew Davis or other approved signatory
or Other Approved Signatory

None Detected = <0.1%. EMSL maintains liability limited to cost of analysis. This report relates only to the samples reported above and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client. Samples received in good condition unless otherwise noted. This report must not be used to claim product endorsement by NVLAP of any agency or the U.S. Government

Samples analyzed by EMSL Canada Inc. Mississauga, ON NVLAP Lab Code 200877-0

Initial report from: 11/15/2019 10:56:03

Appendix F SUMMARY OF RESULTS OF ANALYSIS OF PAINT CHIP SAMPLES FOR LEAD CONTENT



Summary Results of Analysis of Paint Samples for Lead Content

Sample Number	Floor	Sampling Location	Specific Location	Description	Lead Content
633560-PS-01	Exterior	Window	Frame	Brown coloured paint	1,200
633560-PS-02	First	Living room	Drywall wall	Grey coloured paint	140
633560-PS-03	Second	Hallway	Drywall wall	White coloured paint	170
633560-PS-04	First	Foyer	Drywall wall	Beige coloured paint	<81

nd - None Detected
ppm - Parts Per Million
PS - Paint Sample

Appendix G LABORATORY ANALYTICAL REPORT – LEAD: PAINT CHIP ANALYSIS



**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or	551913668
CustomerID:	55JACQ30J
CustomerPO:	122151011.200
ProjectID:	

Attn: **Will Madden-Macavellia**
Stantec Consulting Ltd.
300-675 Cochrane Drive, West Tower
Markham, ON L3R 0B8

Phone: (905) 474-7700
 Fax: (905) 479-9326
 Received: 11/11/19 10:45 AM
 Collected: 11/7/2019

Project: 122151011.200 - PIN #633560

Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)*

<i>Client SampleDescription</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>RDL</i>	<i>Lead Concentration</i>
633560-PS-01 551913668-0001	11/7/2019	11/12/2019	0.2462 g	81 ppm	1200 ppm
	Site: Exterior Window - Frame Desc: Brown Coloured Paint				
633560-PS-02 551913668-0002	11/7/2019	11/12/2019	0.2460 g	81 ppm	140 ppm
	Site: First Floor Living Room - Drywall wall Desc: Grey Coloured Paint				
633560-PS-03 551913668-0003	11/7/2019	11/12/2019	0.2460 g	81 ppm	170 ppm
	Site: Second Floor Hallway - Drywall wall Desc: White Coloured Paint				
633560-PS-04 551913668-0004	11/7/2019	11/12/2019	0.2473 g	81 ppm	<81 ppm
	Site: First Floor Foyer - Drywall wall Desc: Beige Coloured Paint				

Rowena Fanto, Lead Supervisor
 or other approved signatory

*Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.008 % wt based on the minimum sample weight per our SOP. Unless noted, results in this report are not blank corrected. This report relates only to the samples reported above and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities. Samples received in good condition unless otherwise noted. "<" (less than) result signifies the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. The QC data associated with the sample results included in this report meet the recovery and precision requirements unless specifically indicated otherwise. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON A2LA Accredited Cert #2845.08; AIHA-LAP, LLC - ELLAP #196142

Initial report from 11/15/2019 08:36:20

Appendix H EVALUATION CRITERIA FOR ASSESSING ASBESTOS-CONTAINING MATERIALS



CRITERIA FOR ASSESSING ASBESTOS-CONTAINING MATERIALS

A description of the criteria used in evaluating the condition, accessibility and exposure risk of asbestos-containing materials is provided below. The criteria are generally based on the PSPC *Asbestos Management Standard* and industry standards of practice.

ASSESSMENT OF CONDITION

Spray Applied Fireproofing, Insulation and Textured Finishes

In evaluating the condition of asbestos-containing material spray applied as fireproofing, thermal insulation, or texture, decorative or acoustic finishes, the following criteria apply:

GOOD

Surface of material shows no significant signs of damage, deterioration or delamination. Up to one percent of the surface area having visible damage to surface is allowed within range of GOOD. Evaluation of sprayed fireproofing requires the assessor to be familiar with the irregular surface texture typical of sprayed asbestos products. GOOD condition includes un-encapsulated or unpainted fireproofing, insulation or texture finishes where no delamination or damage is observed, and encapsulated fireproofing, insulation or texture finishes where the encapsulation has been applied after the damage or fallout occurred.

POOR

Sprayed materials show signs of damage, delamination or deterioration. More than one percent damage to surface of asbestos-containing material spray.

In observation areas, where damage exists in isolated locations, both GOOD and POOR condition may be reported. The extent or percentage of each condition will be recorded on the survey or reassessment form.

NOTE: FAIR condition is not used or considered as a valid criterion in the evaluation of sprayed fireproofing, sprayed insulation, or texture coat finishes.

The evaluation of asbestos-containing material spray applied as fireproofing, non-mechanical thermal insulation, or texture, decorative, or acoustic finishes which are present above ceilings may be limited by the number of observations made, and by building components such as ducts or full-height walls that obstruct the above-ceiling observations. Persons entering the ceiling area are advised to be watchful for asbestos-containing material debris prior to accessing or working above ceilings in areas of buildings with asbestos-containing material, regardless of the reported condition.



Detection Limit of Bulk Analysis

Asbestos-containing material is defined as any material found to contain asbestos at or above the limit defined by provincial/territorial standards for an asbestos-containing material, as determined by the allowable analytical method for the analysis of bulk samples. Except in the case of vermiculite, the provincially/territorially regulated limits or generally accepted guidelines to consider a material as an asbestos-containing material, subject to asbestos in buildings regulation, are provided as follows:

The minimum concentration to consider as an asbestos-containing material in Ontario is 0.5%

Vermiculite is considered an asbestos-containing material in the presence of any concentration of asbestos measured in a composite sample taken in accordance with provincial/territorial sampling standards.

Mechanical Insulation

In evaluating the condition of mechanical insulation (on boilers, breeching, ductwork, piping, tanks, equipment, etc.) the following criteria are used:

GOOD Insulation is completely covered in jacketing and exhibits no evidence of damage or deterioration, i.e. no insulation is exposed. Includes conditions where the jacketing has minor surface damage (i.e. scuffs or stains), but the jacketing is not penetrated.

FAIR Minor penetration damage to jacketed insulation (cuts, tears, nicks, deterioration or delamination), or undamaged insulation that has never been jacketed. Insulation is exposed but not showing surface disintegration. The extent of missing insulation should range from minor to none.

POOR Original insulation jacket is missing, damaged, deteriorated or delaminated. Insulation is exposed and significant areas have been dislodged. Damage cannot be readily repaired.

The evaluation of mechanical insulation may be limited by the number of observations made and building components such as ducts or full-height walls that obstruct observations. In these circumstances, it is not possible to observe each foot of mechanical insulation from all angles.

Non-Friable and Potentially-Friable Materials

Non-friable materials generally have little potential to release airborne fibers, even when damaged by mechanical breakage, but can become friable if disturbed by drilling or abrading.

However, some non-friable materials, e.g. exterior asbestos cement products, may have deteriorated so that the binder no longer effectively contains the asbestos fibers. In such cases of significantly deteriorated non-friable material, the material will be treated as a friable product.



Asbestos-Containing Material Debris

The presence of fallen friable asbestos-containing material is noted separately from the presumed friable asbestos-containing material source (sprayed fireproofing, thermal insulation, texture, decorative or acoustic finishes or mechanical insulation) and is referred to as debris.

The presence of fallen asbestos-containing material from damaged non-friable asbestos-containing material is reported separately from the non-friable asbestos-containing material source. Fallen non-friable asbestos-containing material that has become friable is reported as debris. Workers are advised to be watchful for the presence of debris prior to accessing, or working in proximity to, mechanical insulation or above ceiling areas of buildings with asbestos-containing material, regardless of the reported presence or absence of debris.

Evaluation of Accessibility

The accessibility of building materials known or suspected of being asbestos-containing material is rated according to the following criteria:

- ACCESS (A)** Areas of the building within reach (from floor level) of all building users. Includes areas such as gymnasiums, workshops, and storage areas where activities of the building users (e.g. basketball on gym ceiling) may result in disturbance of asbestos-containing material not normally within reach from floor level.
- ACCESS (B)** Frequently entered maintenance areas within reach of maintenance staff, without the need for a ladder. Includes: frequently entered pipe chases, tunnels and service areas or areas within reach from a fixed ladder or catwalk, e.g. tops of equipment, mezzanines.
- ACCESS (C)**
EXPOSED Areas of the building above 8'0" where use of a ladder is required to reach the asbestos-containing material. Only refers to asbestos-containing material materials that are exposed to view, from the floor or ladder, without removing or opening other building components such as ceiling tiles, or service access doors or hatches. Does not include infrequently accessed service areas of the building.
- ACCESS (C)**
CONCEALED Areas of the building which require the removal of a building component, including lay-in ceilings and access panels into solid ceiling systems such as a ventilation plenum. Includes rarely entered crawl spaces, attic spaces, etc. Observations are limited to the extent visible from the access points.
- ACCESS (D)** Areas of the building behind inaccessible solid ceiling systems, walls, or mechanical equipment, etc., where demolition of the ceiling, wall or equipment, etc., is required to reach the asbestos-containing material. Evaluation of condition and extent of asbestos-containing material is limited or impossible, depending on the assessor's ability to visually examine the materials in areas rated Access (D).



ACTION MATRIX AND ACTION DESCRIPTIONS

The action matrix prioritizes the corrective actions in terms of potential health risk based on condition, accessibility, and potential for future disturbance.

The following factors are considered in making site-specific recommendations for corrective actions in conformance with the existing applicable regulation or codes of practice, and for the practical implementation of asbestos management:

1. Asbestos-containing material in POOR condition is not routinely repairable. If an abatement action is necessary, removal is the recommended action (enclosure is a viable option in unusual circumstances, e.g. where removal is difficult or costly and the asbestos-containing material can be thoroughly enclosed).
2. Mechanical insulation in FAIR condition will be repaired or removed based on the following general recommendations, applied on a case-by-case basis:
 - a. Asbestos-containing mechanical insulation found in FAIR condition in ACCESS (B) or ACCESS (C) EXPOSED areas is to be repaired.
 - b. Asbestos-containing mechanical insulation found in FAIR condition in ACCESS (B) and ACCESS (C) EXPOSED areas, where future damage to the asbestos-containing material is likely to occur, is to be removed.
3. Asbestos-containing material in GOOD condition present in ACCESS (A) can be managed by surveillance, as long as it is not disturbed by future renovation, maintenance or demolition. Proactive removal of the asbestos-containing material in ACCESS (A) will be considered where damage is possible by ongoing occupant activity (accidental or intentional).
4. Non-friable or manufactured products are considered in the action matrix as follows:
 - a. Non-friable and manufactured products reported in POOR condition, or friable DEBRIS resulting from the deterioration of non-friable asbestos-containing material, are treated as friable materials and the appropriate action, depending on accessibility, is determined from the action matrix for friable asbestos-containing material.
 - b. For non-friable or manufactured products reported in GOOD condition, Action 7 (surveillance) is recommended regardless of accessibility.
5. All asbestos-containing material from a particular area is to be removed where small quantities of asbestos are present, and removal will negate the need for the use of an Asbestos Management Program in that area.



The action matrix provided below establishes the recommended asbestos control action. The ACTIONS themselves are described in full following the table.

ASBESTOS-CONTAINING MATERIAL				
ACCESS	CONDITION			DEBRIS
	GOOD	FAIR	POOR	
(A)	ACTION 5/7 ¹	ACTION 5/6 ²	ACTION 3	ACTION 1
(B)	ACTION 7	ACTION 6/5 ³	ACTION 3	ACTION 1
(C) exposed	ACTION 7	ACTION 6	ACTION 4	ACTION 2
(C) concealed	ACTION 7	ACTION 7	ACTION 4	ACTION 2
(D)	ACTION 7	ACTION 7	ACTION 7	ACTION 7
¹ If material in ACCESS (A)/GOOD condition is not removed, ACTION 7 is required. ² If material in ACCESS (A)/FAIR condition is not removed, ACTION 6 is required. ³ Remove asbestos-containing material in ACCESS (B)/FAIR condition if asbestos-containing material is likely to be disturbed.				

ACTION 1 Immediate clean-up of debris that is likely to be disturbed.

Access that is likely to cause a disturbance of the ASBESTOS-CONTAINING MATERIAL DEBRIS is to be restricted and clean up ASBESTOS-CONTAINING MATERIAL DEBRIS is to be done immediately. Use correct asbestos procedures. This action is required for compliance with regulatory requirements and good practice. The assessor should immediately notify the Asset or Property and Facility Manager, or Regional/Area Asbestos Management Coordinator of this condition.

ACTION 2 Entry into areas with asbestos-containing material debris requires intermediate risk precautions.

At locations where ASBESTOS-CONTAINING MATERIAL DEBRIS can be isolated in lieu of removal or cleaned up, appropriate means to limit entry to the area is to be used. Access to the area is restricted to persons using intermediate risk asbestos-work precautions. The precautions will be required until the ASBESTOS-CONTAINING MATERIAL DEBRIS has been cleaned up, and the source of the DEBRIS has been stabilized or removed following intermediate risk (if minor) or high-risk precautions.

ACTION 3 Asbestos-containing material removal required for compliance.

Asbestos-containing material must be removed for compliance with regulatory requirements and good practice. Use asbestos procedures appropriate to the scope of the removal work.



DESIGNATED SUBSTANCE AND HAZARDOUS MATERIALS SURVEY
PIN: 633560, 1968 WOODVIEW AVENUE, TORONTO, ON

ACTION 4 Access into areas where asbestos-containing material is present and likely to be disturbed by access requires intermediate risk precautions.

Intermediate risk asbestos precautions are to be used when entry or access into an area is likely to disturb the asbestos-containing material. ACTION 4 must be used until the asbestos-containing material is removed (Use ACTION 1 or 2 if DEBRIS is present). Intermediate risk or high-risk precautions should be used for removal (depending on extent of removal).

ACTION 5 Proactive asbestos-containing material removal.

Removal of asbestos-containing material in lieu of repair may be considered, even if it is in GOOD condition at locations, where asbestos-containing material is easily accessible, limited in quantity, and removal would be cost-effective.

ACTION 6 Asbestos-containing material repair.

Asbestos-containing material may be repaired if found in FAIR condition and not likely to be damaged again or disturbed by normal use of the area or room. Upon completion of the repair work, asbestos-containing material is to be treated as being in GOOD condition and ACTION 7 is to be implemented. If asbestos-containing material is likely to be damaged or disturbed during normal use of the area or room, ACTION 5 is to be implemented.

ACTION 7 Routine Surveillance.

Routine surveillance of the asbestos-containing material is to be instituted. Trained workers or service providers must use appropriate asbestos precautions (low, intermediate or high) during disturbance of the remaining asbestos-containing material.

