



PANEL 1 scale = 1:75


PANEL 2 & 3 scale = 1:75

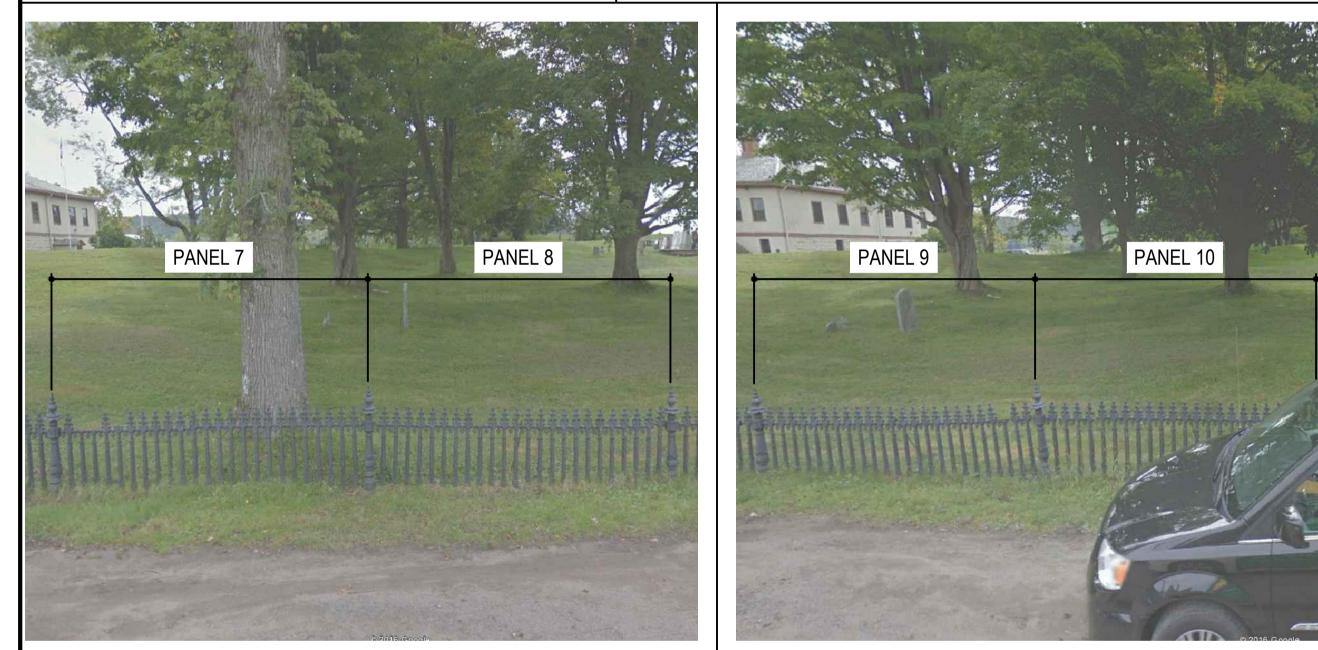


PANEL 7 & 8 scale = 1:75


PANEL 9, 10 & 11 scale = 1:75

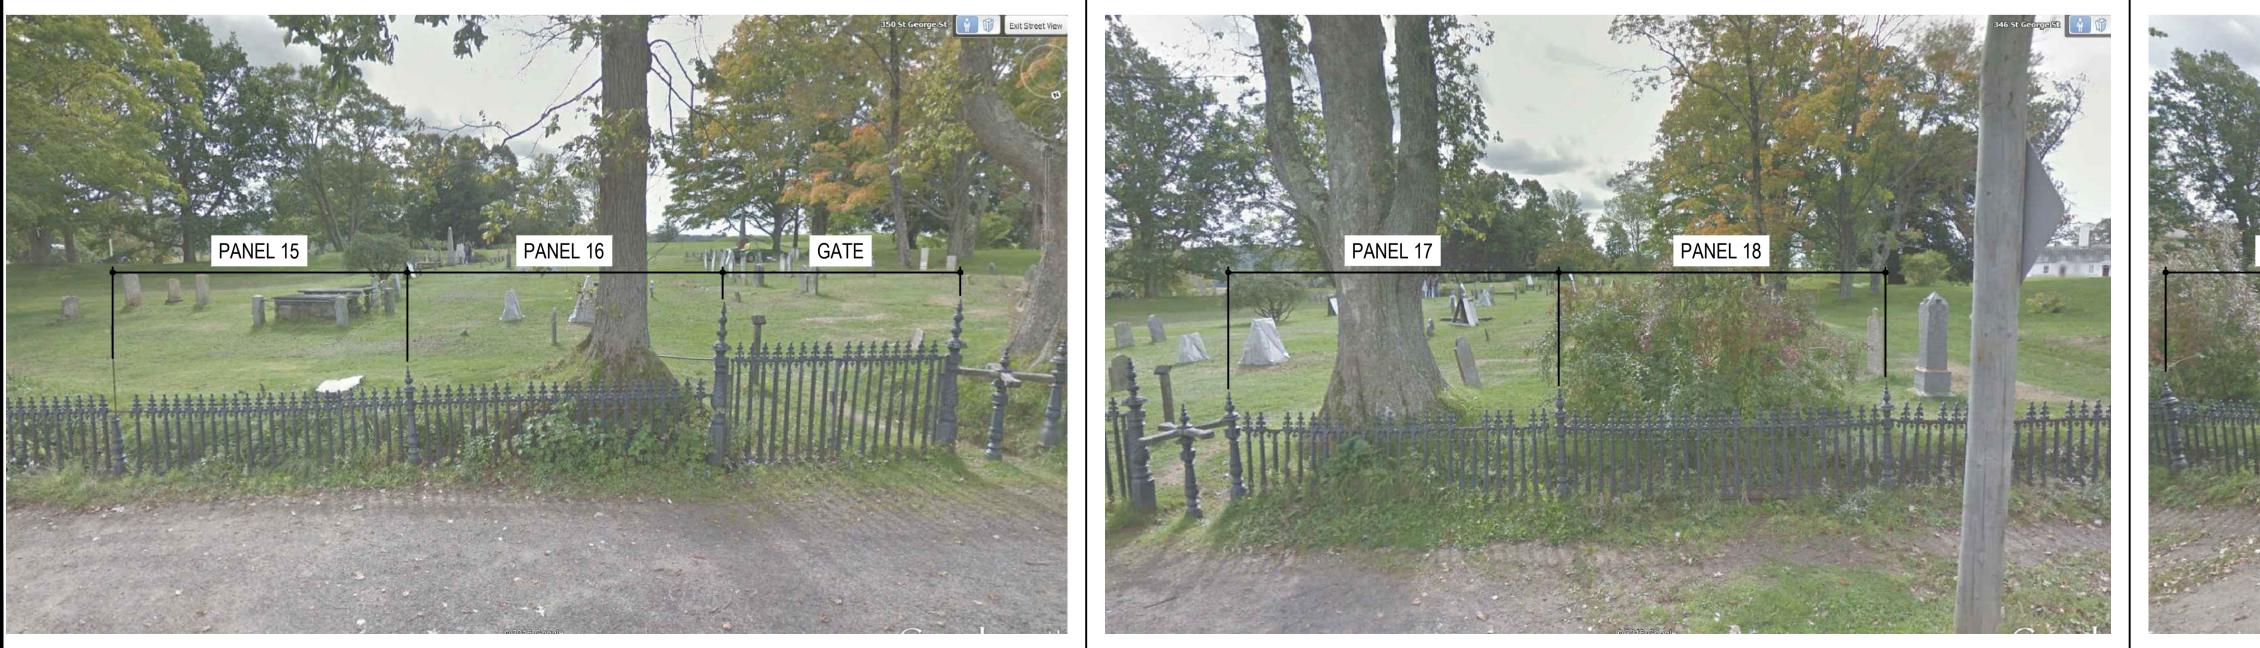

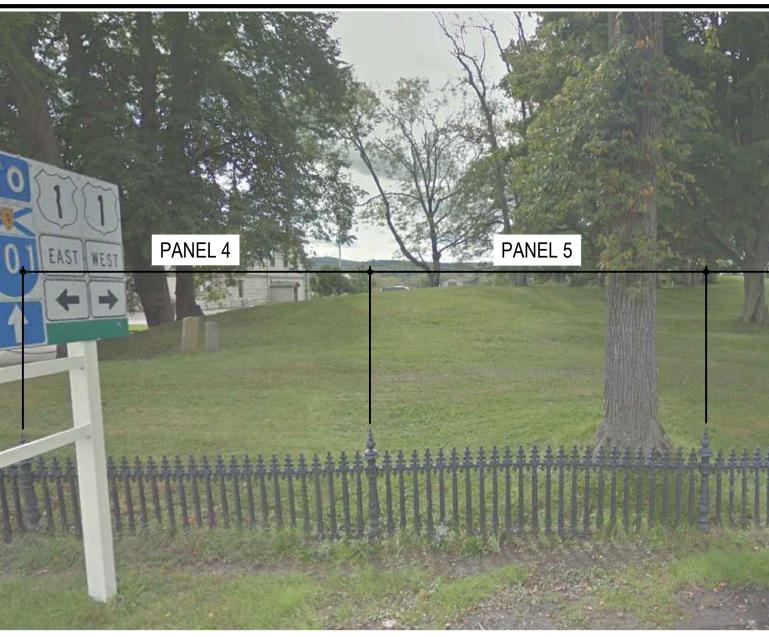

PANEL 4, 5 & 6 scale = 1:75

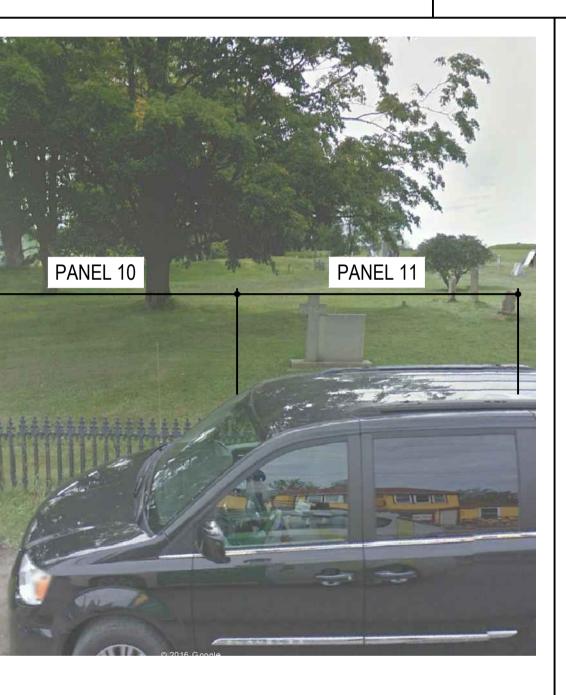


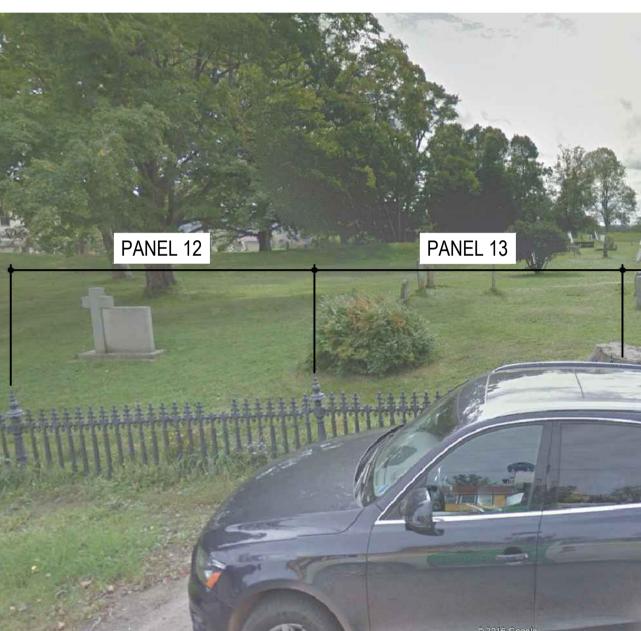

PANEL 12, 13 & 14 scale = 1:75


PANEL 17 & 18 scale = 1:75

<complex-block></complex-block>	KEY	PLAN	я		SCA	ALE = 1:10,000
<image/>	04 03 02 01 NO.	ISSUED FOR TENDE RS4 SUBMISSION FO RS4 SUBMISSION FO ISSUED FOR RS2 DESCRIPTION	or tender revi or review	<b>CS</b> [	blan+de	, NS B2Y 4V7 vw.ekistics.net
<image/>	Landscape Architecture Engineering Architecture   CLENT CLENT PARKS CANADA Image: Clean and the second and t					
	1:7 DRAWN DJ		CHECKED	2016/0	7/18 PROJECT NO. 16-019	L-101

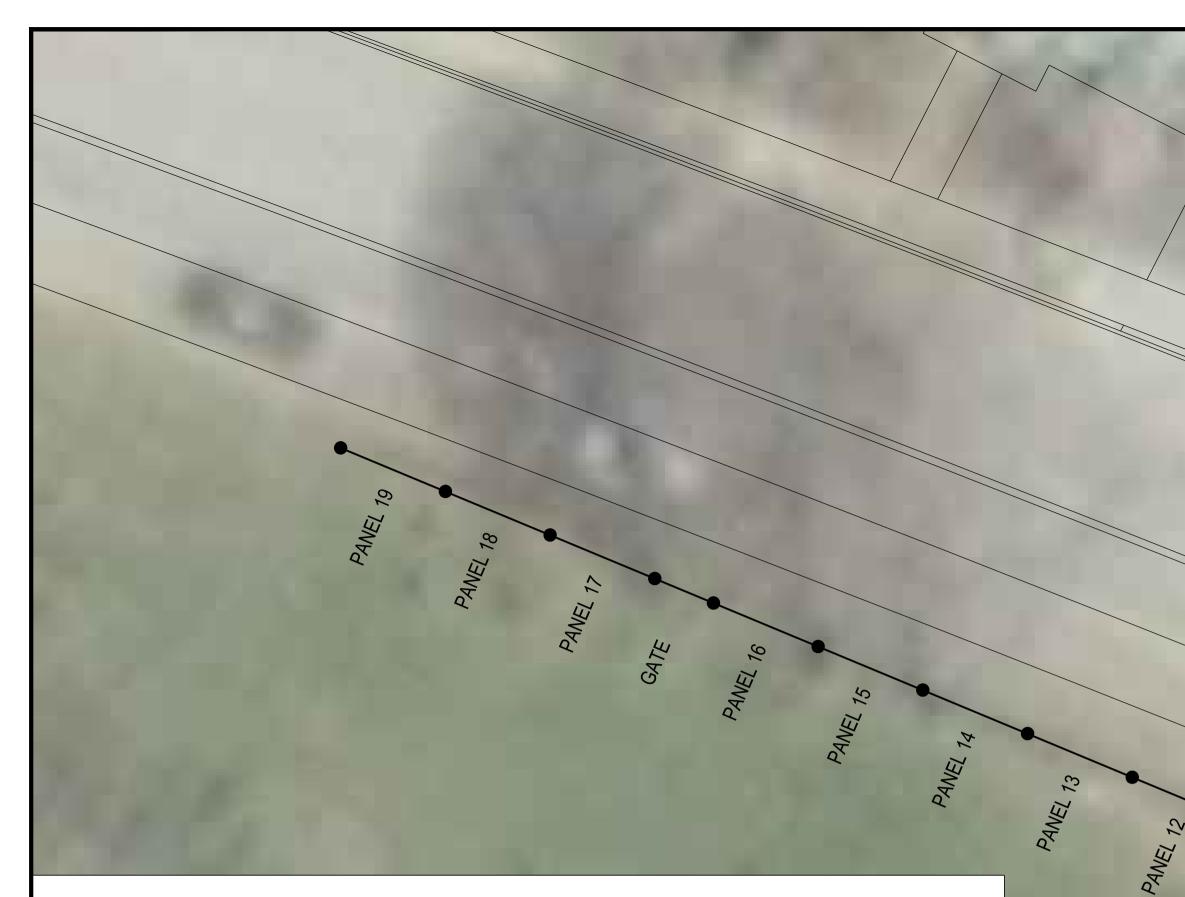


## Ft. Anne, Annapolis Royal NHS Cemetery Fence.

Panel #	BALUSTRADES	ne Courthouse sid HORIZONTAL ROD	CENTRE SUPPORT	GENERAL COMMENT
1	24 good cond.	Good cond.	ОК	Panels 1,2 &3 where taken apart and re instated approx. 8 yrs ago by Park staff.
2	24 good cond.	Good cond.	ок	o yre age by Fark etan.
3	24 good cond.	Good cond.	ОК	
4	24 good cond.	Poor cond.	ОК	Panel in good condition however horizontal rod needs to be scraped, sealed and painted (in situ.)
5	24 good cond.	Poor cond.	Into a tree needs to be removed and re set.	Same comment as above.
6	24 good cond.	Poor cond.	Loose. Needs reconnected.	Same comment as above.
7	3 broken and 1 cracked.	V.poor condition	Into a tree needs to be removed and reset.	Remove panel and dismember treat and re assemble using new rod. &replaced balustrades.
8	1 broken , 1 cracked and 1 partially cracked.	v. poor condition	Loose .	Remove panel and dismember, treat and re assemble using new rod. &replaced balustrades. Panel is bent.
9	1 broken, 3 cracked	v. poor condition	loose	Remove panel and dismember, treat and re assemble using new rod. &replaced balustrades.
10	24 good condition	Reasonable .see comments	loose	Panel in good condition however horizontal rod needs to be scraped, sealed and painted (in situ.)
11	3 broken, 1 cracked.	v. poor condition	Need to replace,	Remove panel and dismember treat and re assemble using new rod. &replaced balustrades.
12	2 broken, 1 cracked	Poor condition	ОК	Remove panel dismember treat and re assemble using new rod and replace balustrades.
13	4 broken, 1 cracked	Poor condition	ОК	Remove panel dismember treat and re assemble using new rod and replace balustrades.
NOTE				Post between panels 13 and 14 has shifted.
14	24 good condition	Reasonable: see comments	OK Large tree stump behind.	Panel and rod could be scraped, treated and sealed etc. (in situ.)
NOTE				Post between Panels 14 and 15 completely broken.
15	24 good condition	Reasonable; see comments	Small tree stump. Remove centre support and relocate,	Panel and rod could be scraped, treated and sealed etc. (in situ.) Will have to reconnect S.side to new post.
NOTE			,	Post between Panels 15 and 16 has 2 small cracks. Care needed when re setting.
16	1 broken	Reasonable	NO centre support.	Panel v. close to large tree. Remove panel dismember treat and re assemble using new rod and replace balustrade.
GATE	8 balustrades per side. All in good cond.	Both rods in good condition.	Remove support rod from S.gate post and tree. Reset in other location.	2 gate posts in excellent condition 2 gate panels could be treate in situ.
TURN Style			_	In goog condition. Clean and treat wooden X bars.
17	7 broken	v. poor cond.	Goes into tree.	This panel is very close to a large tree. Panel is bent. Remove panel dismember treat and re assemble using new rod and replace balustrades.
18	2 broken, 1 cracked.	v. poor cond.	loose	Remove panel dismember treat and re assemble using new rod and replace balustrades.
19	6 broken, 3 cracked	v. poor condition.	loose	Remove panel dismember treat and re assemble using new rod and replace balustrades.
NOTE				Final post(Town side) in good condition.

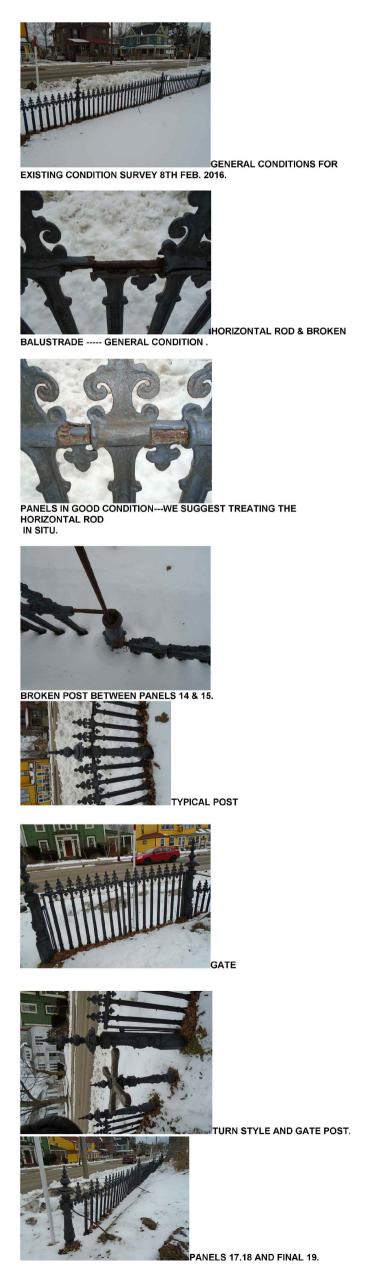

## PLEASE NOTE: THE LINE WC ON THIS PLAN IS FOR REFE IT IS NOT SURVEY ACCURAT

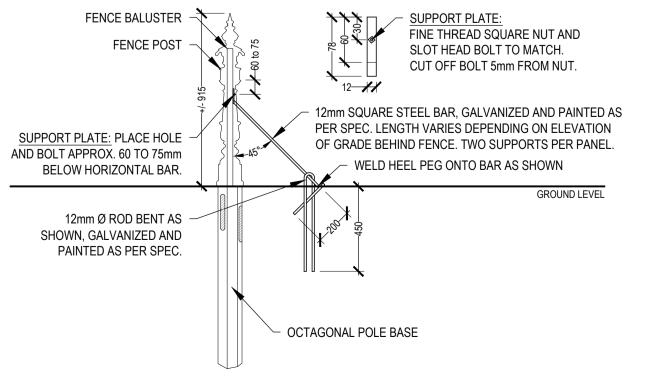



SUPPORT BAR SECTION, scale 1:20

ST. GEORGE STREET

17

PANEL 10

PANEL 9

PANEL 8

PANEL

12

PLEASE NOTE: THE LINE WO ON THIS PLAN IS FOR REFE IT IS NOT SURVEY ACCURAT	RENCE ONLY.		ANNAPOLIS RIVE	R		
		KEY PL	AN		/// 30	ALE = 1:10,000
APPROXIMATE LOCATION OF EXISTING CONCRETE SIDE	WALK					
APPROXIMATE LOCATION OF EXISTING GP.						
PANEL 3 PANEL 3 VEL 2 VEL 2		03 RS- 02 RS- 01 ISS	SUED FOR TENDE 34 SUBMISSION FC 34 SUBMISSION FC SUED FOR RS2 SUED FOR RS2 SCRIPTION	OR TENDER REVIEW		JULY 18, 2016 JUNE 3, 2016 APRIL 22, 2016 MARCH 24, 2016 DATE
And the second se		je,	ek	1	Starr Lane, Dartmouth 902.461.2525 ww	, NS B2Y 4V7 ww.ekistics.net
ND T.	ROTING OF THE OPTIME OF THE OP	CLIENT	(S CANAI	DA		
AINTED AS EVATION R PANEL.	ROTINATION	NATIO ANNAPO SHEET DESCR	DLIS ROYAL, NC RIPTION CE REC	STORIC SITE VA SCOTIA ONSTRUCTIO		
	0 3 6 1:150	SCALE 1:75 DRAWN DJH		DATE 2016/0 CHECKED TG		sheet L-102