






LEGEND	
	DENOTES EXISTING RIVET OR BOLT
	DENOTES EXISTING RIVET OR BOLT TO BE REPLACED WITH NEW BOLT
	DENOTES NEW BOLT

Do not scale drawings.  
Verify all dimensions and conditions on site and  
immediately notify the engineer of all discrepancies.

project title

Kingston, Ontario  
PSPC  
LaSalle Causway  
Bascule Bridge

drawing title






ABOVE DECK REPAIR DETAILS  
SHEET 1

designed by  
JEAN-BERNARD CHARRON


tender	project manager
RANYA EL SADAWY	

project no. R.097736.002

---

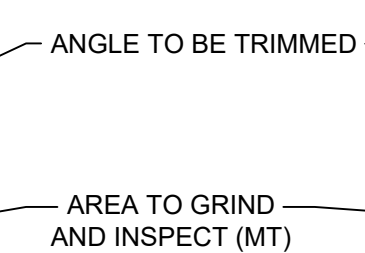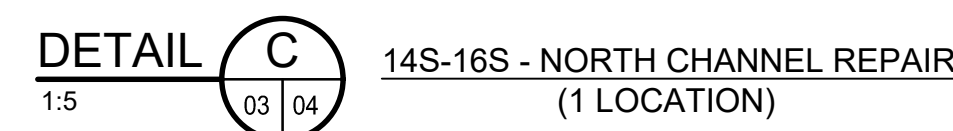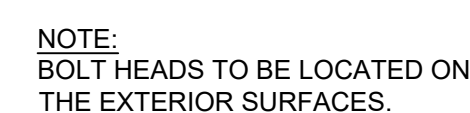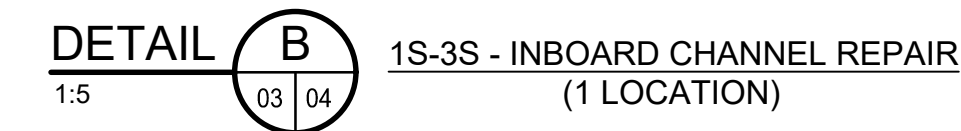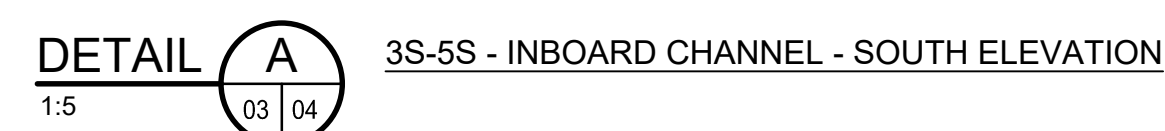

8S-9S DIAGONAL - SIGN SUPPORT ANGLE TO BE TRIMMED

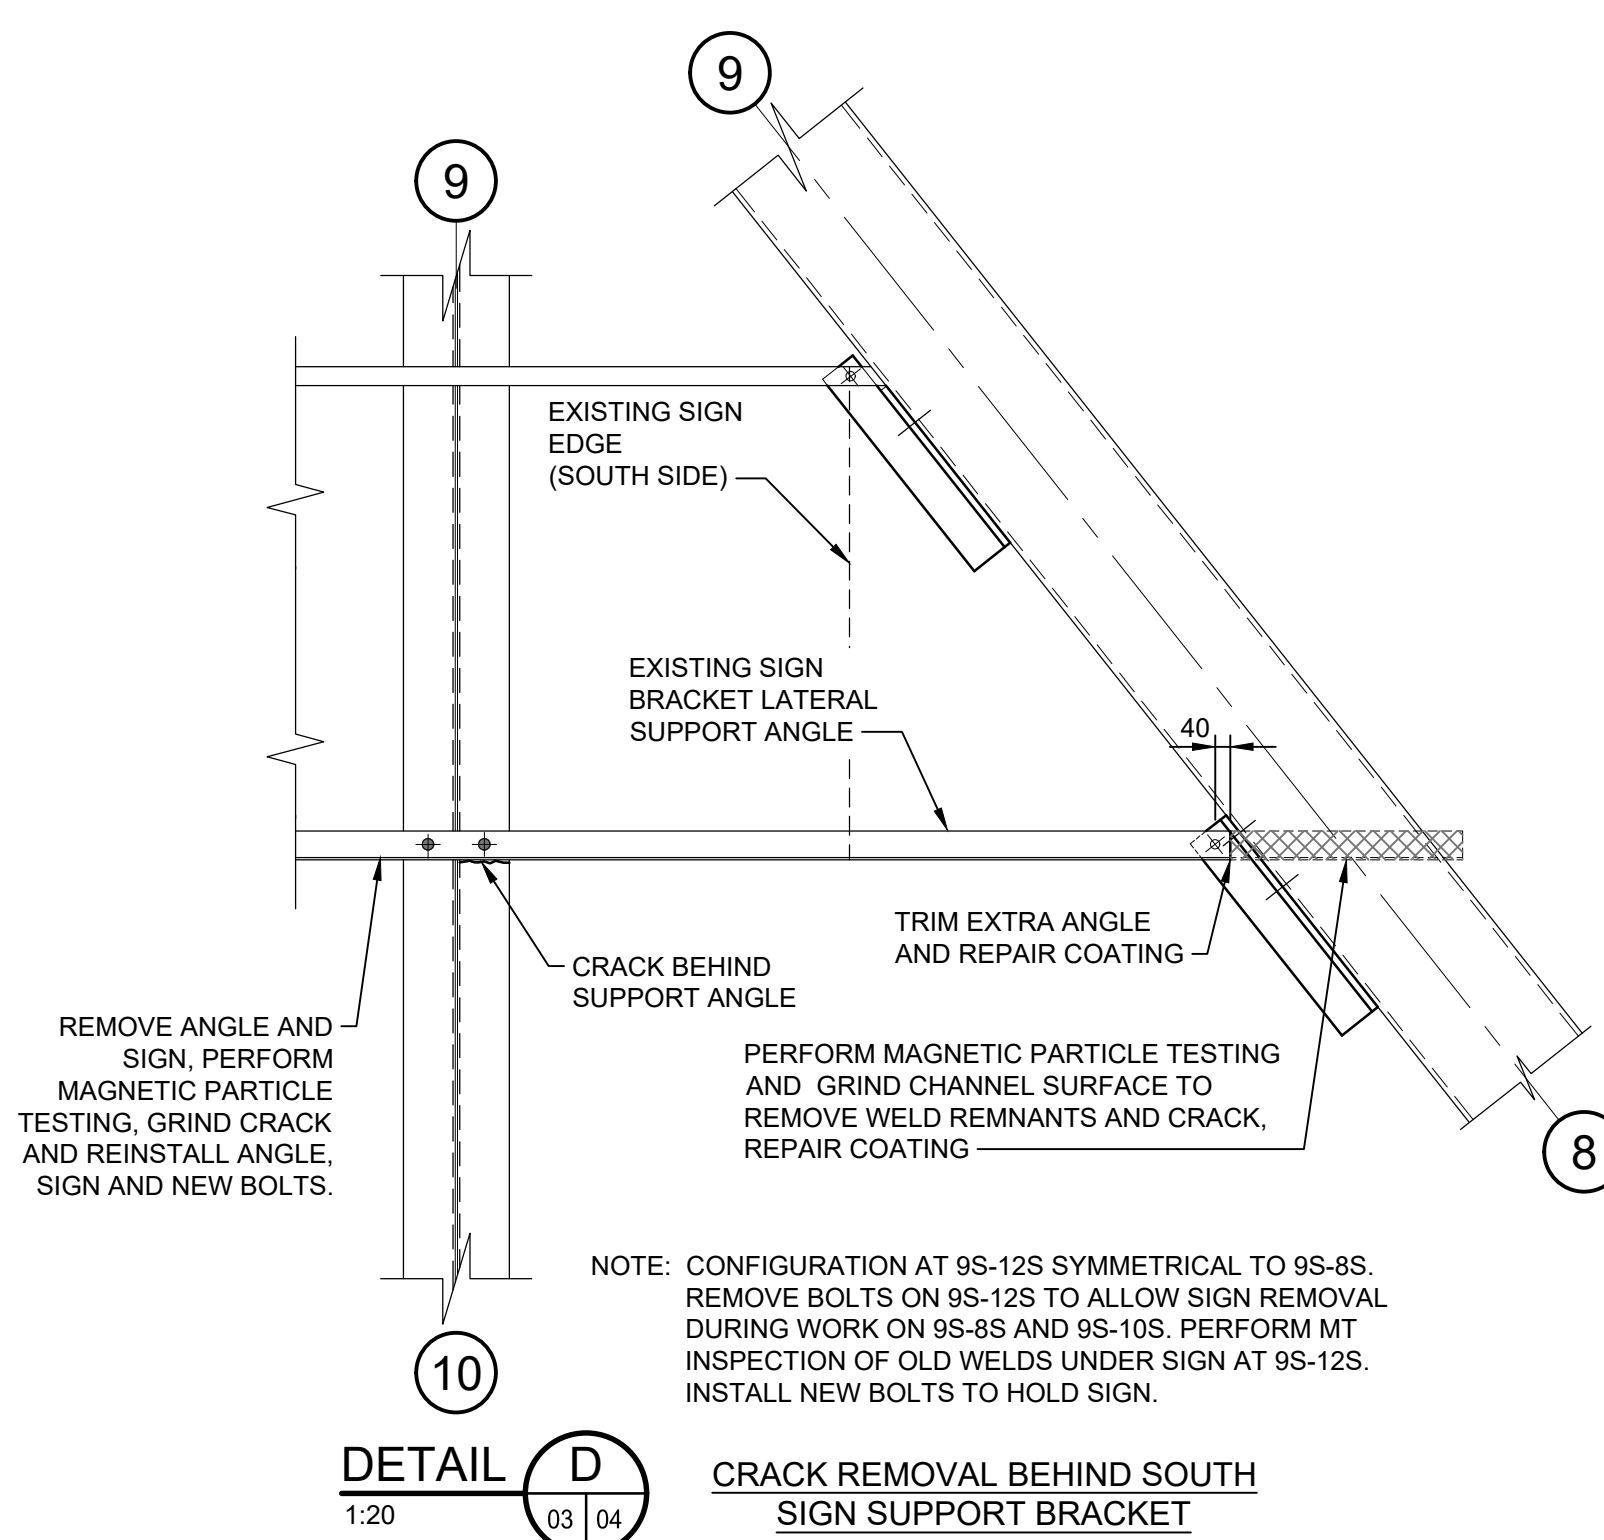

NOTE: CONFIGURATION AT 9S-12S SYMMETRICAL TO 9S-8S.  
REMOVE BOLTS ON 9S-12S TO ALLOW SIGN REMOVAL  
DURING WORK ON 9S-8S AND 9S-10S. PERFORM MT  
INSPECTION OF OLD WELDS UNDER SIGN AT 9S-12S.  
INSTALL NEW BOLTS TO HOLD SIGN.

DETAIL  CRACK REMOVAL BEHIND SOUTH  
1:20 SIGN SUPPORT BRACKET